



मध्यप्रदेश प्रदूषण नियंत्रण बोर्ड

पर्यावरण परिसर, ई-5, अरेरा कॉलोनी, भोपाल- 462016 (म.प्र.) ई-मेल द्वारा
Te 0755-2464428, 2466191 Fax: 0755-2463742

क्रमांक/...20..../मॉ.शा. / फा.नं. NW-16 (VII) /2024 भोपाल, दिनांक.29/01/2024

प्रति,

पी.के. मिश्रा,
प्रभाग प्रमुख, डब्ल्यू.क्यू.एम-1 डिवीजन
केन्द्रीय प्रदूषण नियंत्रण बोर्ड,
परिवेश भवन, ईस्ट अर्जुन नगर,
नई दिल्ली - 110032

विषय :- मूर्ति विसर्जन मार्गदर्शिका, मई 2020 के प्रभावी पालन के सम्बन्ध में
की गई कार्यवाही संबंधी प्रतिवेदन।

सन्दर्भ:- आपका पत्र क्रमांक F.No-A--14011/1/2023/WQM-1/3504, Dated 24.08.2023

उपरोक्त विषयान्तर्गत प्राप्त सन्दर्भित पत्र के परिप्रेक्ष्य में मूर्ति विसर्जन
की संशोधित गाइडलाइन में उल्लेखित निर्देशानुसार मध्यप्रदेश प्रदूषण नियंत्रण बोर्ड
द्वारा की गई कार्यवाही का प्रतिवेदन संलग्न कर कृपया प्रेषित है।

संलग्न :- उपरोक्तानुसार


(डॉ. अभय कुमार सक्सेना)
वरिष्ठ वैज्ञानिक अधिकारी

प्रतिलिपि:- क्षेत्रीय निदेशक, क्षेत्रीय निदेशालय (मध्य), केन्द्रीय प्रदूषण नियंत्रण बोर्ड,
भोपाल की ओर सूचनार्थ।

Action Taken Report

During Ganesh Chaturthi and Durga Pooja

Year- 2023



In the context of idol immersion
Guidelines Issued by Central Pollution Control Board
And
The Hon'ble National Green Tribunal's order dated
21/9/2018 OA NO. 673/2018



Madhya Pradesh Pollution Control Board
Paryavaran Parisar E-5, Arera Colony, Bhopal - 462016(M.P.)
Tel: 0755-2464428,2466191 Fax: 0755-2463742<https://mppcb.mp.gov.in/>

Idol immersion- Action Taken Report

Ganesh Chaturthi and Durga Puja are auspicious festivals celebrated every year throughout the country. During these festivals, Maa Durga and Bhagwan Ganesha idols are carved, worshipped and later on immersed in nearby water bodies such as rivers, lakes and ponds by the devotees. These idols are generally made up of clay, Plaster of Paris (PoP), thermocol accessories, plastic materials and other decorative items and are also painted with harmful inorganic paints/ colors. When these idols are released in water bodies after worship, they contaminate them by dissolving various pollutants and thereby degrading the water quality of receiving water bodies. Increased use of Plaster of Paris (PoP) based idols, use of dyes containing toxic metals, plastic and thermocol accessories for decoration and immersion of such idols in water bodies causes pollution.

While celebrating Ganesh Chaturthi and Durga Puja festivals people generally ignore environmental impact of pollution on Air, Water, Noise, solid Waste, etc caused by various activities performed in puja. Increase in consumerism during the festival increases traffic congestion which in turn increases air pollutants, which are released into the atmosphere by vehicles. The celebration of Ganapati and Durga Puja festivals lead to increase in the level of harmful gases in atmosphere like Sulphur dioxides (SO₂), Carbon Monoxides (CO), etc.

In recent years, we have seen increased awareness about water pollution caused by visarjan i.e. immersion of Ganesh and Durga Idols in lakes, rivers and Sea which are made out of Plaster of Paris (PoP) i.e. calcium sulphate hemi –hydrate. It takes several months to totally dissolve Ganesh Idols made up of PoP into water. Also, colors used in decoration of idols contain harmful chemicals containing mercury, lead which leaks into water as idol dissolves. It increases acid content, Total Dissolved solids (TDS) and Heavy metals in water. It kills aquatic plants and marine life, damaging ecosystem under water. Along with Ganesh & Durga idols people dump other accessories like thermocol, plastics, etc. as well adding to the level of water pollution.

Devotees celebrate the prestigious festival with all possible means of loud music like listening to bhajans, kirtans and songs using massive speakers. During Anant Chaturdashi and Durga Visergen, which is the final day of these auspicious festivals, we witness heavy traffic on the roads, which leads to an increase in Air (particles from vehicles) and Noise (excessive honking) pollution.

Along with Idols several other accessories are used in worship of Ganapati and Durga Puja and Durga Puja such as, flowers, fruits, coconuts, camphor, cloth, plastic, thermocol. Etc. It is collectively called as Nirmalya. Every year government spends crores of rupees to clean and dig out tons of garbage from natural water sources such as rivers, lakes etc.

Considering the pollution caused by this activity in natural water bodies, Hon'ble Court passed an order for CPCB to prescribe "Guidelines for Idols immersion", which initially was issued in the year 2010 and subsequently was revised and issued in May, 2020 effective from 01.01.2021 by Central Pollution Control Board.

Further, Hon'ble NGT in the matter of OA No. 673/2018 has specifically emphasized for prohibition of idol immersion in to rivers and water bodies and observe that chief Secretaries may issue directions to concerned departments for creation of artificial ponds, if found absolutely necessary (as done in NCR Delhi region for preventing pollution in river Yamuna) for idol immersion during festivals like Ganesh Chaturthi and Durga Pooja specifying prior permission of district administration and strict time lines pertaining to religious days only.

That Hon'ble NGT has also directed that any one violating the NGT's orders/ directions shall be liable for environmental compensation @ Rs. 50,000/- and such other penal actions, as may be deemed appropriate in accordance with law. Further, violation of directions issued under sec.5 of the E P Act, 1986 or the rules made their under shall be punished under section 15 of the said act which includes imprisonment up to 05 years and/ or with fine which may extend up to Rs. one lakhs or with both. Considering above, NMCG reiterates directions issued on dated 16/09/19 impressing upon the State Govt. /authorities for their strict compliance.

During recent years, there has been availability of various substitute materials for idol making, safe disposal measures such as visargan in artificial kunds/ponds and environment friendly decorative items to prevent our natural water bodies from pollution.

For effective implementation of “Revised Guidelines for Idols immersion” and directions issued by Hon’ble NGT in the matter of OA No. 673/2018, all the Regional Offices of MP Pollution Control Board has organised awareness raising workshops, displayed posters and banners and distributed pamphlet for information dissemination, awareness raising and publicity. News articles were also publications in newspapers which results in increase in the number of eco-friendly idols and medium and small sized sculptures in recent years.

The local authority, municipal corporations and municipalities prepared temporary visargan kunds for immersing the idols in accordance with the guidelines resulting in preventing the quality of water sources from being impacted. A permanent idol immersion pool / kund were also constructed on the banks of the Narmada River in Amarkantak in order to accommodate the large number of idols that were immersed there throughout the years being holy place. The board is coordinating with the local authorities to maintain clean, pollution free water sources as per the revised guidelines.

To analyse the quality of the water, samples were collected before, during, and one week after the idol immersion from various sites. The point wise action taken report along with photographs, paper cutting of news published in local papers are attached as follows:-

1.No use of synthetic material/nonbiodegradable material,pop, baked clay, resin fibres and thermocol etc. for making of idols (for immersion/ visarjan thereof). use of toxic and non-biodegradable chemical dyes / Synthetic paints for painting ofidolsshould be strictly prohibited.

- ✓ The board ran the following programme, which prohibited the use of pop, baked clay, artificial or nonbiodegradable materials, etc., in the making of idols.

1. Workshops

- ✓ Workshops for making sculptures out of natural materials were organized.



2. Display board



3.Pamphlets

क्षेत्रीय कार्यालय
म.प्र. प्रदूषण नियंत्रण बोर्ड रोवा

अपील

हमारा देश आरुणा/ब्रह्मा से ओल-प्रोत है, ब्रह्मानुसार प्रतिवर्ष आयोजित विभिन्न उत्सवों व त्योहारों के दौरान बड़ी संख्या में मूर्तियाँ/पूजन सामग्री आदि जल स्त्रोतों में विखरित की जाती है। विखरित सामग्री में केमिकल रंग, पेन्ट, वार्निश, पत्थर, पॉलिथीन, धर्माकोल, फूल-मालाएँ इत्यादि होते हैं, जो नदी, तालाब, डैम, कुएँ आदि को जल में मिलकर उसकी गुणवत्ता को प्रभावित करते हैं, तथा इससे पानी में घुलित ऑक्सीजन की मात्रा कम होने की सम्भावना रहती है, जिससे जलीय जीवन प्रभावित होता है। केन्द्रीय प्रदूषण नियंत्रण बोर्ड, नई दिल्ली द्वारा ईको फ्रेंडली मूर्ति निर्माण एवं विसर्जन के सम्बन्ध में नवीन मार्गदर्शिका तैयार की गई है एवं माननीय राष्ट्रीय हरित अधिकरण (एन.जी.टी.) द्वारा भी विज्ञान निर्देश जारी किये गये हैं जिसमें प्रदूषण नियंत्रण बोर्ड के साधन-साधन नगरीय निकायों तथा जिला प्रशासन को प्रथम-पृथक जिम्मेदारियाँ सौंपी गई हैं।

अतः जल स्त्रोतों की स्वच्छता बनाए रखने के लिए सभी नागरिकों से अनुरोध है कि:-

- घरों में पर्यावरण को नुकसान न पहुँचाने वाली ईको फ्रेंडली मूर्तियों का ही उपयोग करें।
- घरों में बड़ी मूर्तियों की स्थापना न करके छोटे आकार की प्राकृतिक पदार्थों से निर्मित मूर्तियाँ स्थापित करें।
- विलस्ते मूर्ति को घर पर ही विखरित करने में आसानी हो।
- प्राकृतिक पदार्थ जैसे- मिट्टी, लकड़ी, कागज आदि से निर्मित ईको फ्रेंडली मूर्तियों का ही उपयोग करें एवं प्लास्टिक हेतु प्लास्टिक, धर्माकोल का उपयोग न करें।
- मूर्तियों को रंगने को रंगीत केमिकल पदार्थ जैसे-रासायनिक रंग, पेन्ट, वार्निश आदि का उपयोग न करें बल्कि प्राकृतिक रंग (हल्दी, कबूतर, पत्तियों आदि से निर्मित) का उपयोग करें।
- केमिकल रंगों से युक्त मूर्तियों को विसर्जन से नदी, तालाब, डैम, आदि का जल प्रदूषित होता है। जो मानव स्वास्थ्य पर विपरीत प्रभाव डालते हैं।
- मूर्तियों को विसर्जन से पूर्व फूल, पत्ती, गन्ना, बरत आदि को प्रथम करके एवं अलग से इकट्ठा निपटान करें।
- नगरीय निकायों द्वारा निर्धारित किए गये मूर्ति विसर्जन स्थलों/अस्थायी कुण्डों पर ही मूर्तियों का विसर्जन करें।
- जहाँ तक सम्भव हो मूर्तियों का विसर्जन घर पर ही करके जल और विसर्जित सामग्री को गमलों/घर के गार्डन में ही प्रवाहित करें।
- पंढारों में स्थापित की जाने वाली मूर्तियाँ सवासम्भव छोटी साइज की स्थापित करें।

सहयोगी की अपेक्षा मैं —
क्षेत्रीय अधिकारी
म.प्र. प्रदूषण नियंत्रण बोर्ड रोवा

तलीक रोवा, भील रोवा

क्षेत्रीय कार्यालय
मध्य प्रदेश प्रदूषण नियंत्रण बोर्ड

अपील

हमारा देश आरुणा/ब्रह्मा से ओल-प्रोत है, ब्रह्मानुसार प्रतिवर्ष आयोजित विभिन्न उत्सवों व त्योहारों के दौरान बड़ी संख्या में मूर्तियाँ/पूजन सामग्री जल स्त्रोतों में विखरित की जाती है। विखरित सामग्री में केमिकल रंग, पेन्ट, वार्निश, पत्थर, पॉलीथीन, धर्माकोल, फूल-पत्तियाँ, फूल-मालाएँ, रस्सावट सामग्री इत्यादि होते हैं, जो नदी, तालाब, डैम, कुएँ आदि को जल में मिलकर उसकी गुणवत्ता को प्रभावित करते हैं तथा इससे पानी में घुलित ऑक्सीजन की मात्रा कम होने की सम्भावना रहती है, जिससे जलीय जीवन प्रभावित होता है। केन्द्रीय प्रदूषण नियंत्रण बोर्ड द्वारा माननीय उच्च न्यायालय के निर्देशानुसार इस सम्बन्ध में वर्ष 2010 में विज्ञान-निर्देश जारी किए गए हैं, जिसमें बोर्ड के साधन-साधन नगरीय निकायों तथा जिला प्रशासन को प्रथम-पृथक जिम्मेदारियाँ सौंपी गई हैं।

अतः जल स्त्रोतों की स्वच्छता बनाए रखने हेतु सभी नागरिकों से बोर्ड का अनुरोध है कि :-

- घरों में पर्यावरण को नुकसान न पहुँचाने वाली (ईको फ्रेंडली) मूर्तियों का ही उपयोग करें।
- घरों में बड़ी मूर्तियों की स्थापना न करके छोटे आकार व प्राकृतिक पदार्थों से निर्मित मूर्तियाँ ही स्थापित करें, जिससे मूर्ति को घर पर ही विसर्जित करने में आसानी हो।
- प्राकृतिक पदार्थ जैसे मिट्टी, लकड़ी, कागज आदि से निर्मित (ईको फ्रेंडली) मूर्तियों को ही उपयोग करें।
- केमिकल पदार्थों जैसे रासायनिक रंग, पेन्ट, वार्निश आदि से युक्त मूर्तियों को विसर्जन से नदी, तालाब, डैम आदि में प्रदूषण की संभावना होती है।
- रासायनिक रंग, पेन्ट, वार्निश आदि पदार्थ पानी में मिलकर पानी को प्रदूषित करते हैं, जो मानव स्वास्थ्य पर विपरीत प्रभाव डालते हैं।
- मूर्तियों विसर्जन के पूर्व फूल-पत्ती, गन्ना, प्लास्टिक, धर्माकोल, पॉलीथीन व वस्त्रादि को प्रथम करके व इनका विसर्जन नदी, तालाब, डैम आदि में न करें।
- नगरीय निकायों द्वारा निर्धारित किए गए मूर्ति विसर्जन स्थलों पर मूर्तियों का विसर्जन करें।
- मूर्तियों का विसर्जन घर पर ही करके जल और विसर्जित सामग्री को गमलों/घर के गार्डन में प्रवाहित कर सकें।
- पंढारों में स्थापित की जाने वाली मूर्तियाँ यथासंभव छोटी स्थापित करें।
- पंढारों में स्थापित मूर्तियों का विसर्जन नगरीय निकायों द्वारा निर्धारित/चिह्नित स्थलों पर ही करें।

नोट- विज्ञान-निर्देशों की विस्तृत जानकारी www.mppcb.nic.in पर देखी जा सकती है।

सहयोग की अपेक्षा मैं - क्षेत्रीय अधिकारी क्षेत्रपाल

पर्यावरण परिसर, ई-5 सेक्टर, अरेरा कालोनी, भोपाल (म.प्र.) फोन-462016
फोन नं. 0755-2466392, ई-मेल: romppcb_bpl@rediffmail.com

क्षेत्रीय कार्यालय
म.प्र. प्रदूषण नियंत्रण बोर्ड

मूर्ति विसर्जन
पर्यावरणीय प्रभाव एवं नियंत्रण

प्राचीन काल से मूर्ति पूजा मानव आस्था का प्रतीक है। मूर्ति पूजा के विवेक प्राकृतिक वस्तुओं जैसे दूध, दही, घी, नारियल, सुपारी आदि का उपयोग किया जाता रहा है। मूर्ति निर्माण भी मिट्टी के द्वारा प्राकृतिक रंगों जैसे हल्दी आदि का उपयोग कर किया जाता रहा है। इन सबके उपयोग से हमारा पर्यावरण पूर्णतः संरक्षित रहा है तथा किसी प्रकार का विपरीत प्रभाव पर्यावरण पर नहीं पड़ा।

वर्तमान समय में मूर्तियों के निर्माण में धातुओं, आधुनिक आभूषणों, तेलीय पदार्थों, सिंथेटिक व रासायनिक रंगों का उपयोग मूर्तियों को पोशिश करने एवं साजसज्जा हेतु किया जा रहा है। मूर्तियों के निर्माण में मिट्टी के स्थान पर प्लास्टिक और पेरिस का उपयोग किया जा रहा है। विसर्जन उपर्युक्त इन सब का विपरीत प्रभाव हमारे प्राकृतिक जल स्त्रोतों एवं पर्यावरण पर पड़ रहा है।

मूर्ति विसर्जन से पर्यावरण पर पड़ने वाले विपरीत प्रभाव -

- मूर्तियों में उपयोगित रासायनिक रंगों में कई प्रकार की भारी धातुएँ होती हैं। जो प्राकृतिक जल स्त्रोतों को प्रदूषित करती हैं।
- मूर्तियों में उपयोगित साजसज्जा सामग्री फूल, पत्ते आदि के विसर्जन से प्राकृतिक जल स्त्रोत प्रदूषित होते हैं।
- प्लास्टिक और पेरिस से निर्मित मूर्तियों जल में काफी समय तक घुलती नहीं हैं।

मूर्ति विसर्जन हेतु केन्द्रीय प्रदूषण नियंत्रण बोर्ड, नई दिल्ली द्वारा जारी दिशा निर्देश

- मूर्ति विसर्जन शासन द्वारा चिह्नित स्थान पर ही किया जाये।
- विसर्जन के पूर्व फूल, पत्तों, कुत्तम आभूषणों आदि को मूर्ति से अलग कर दिया जाये।
- प्लास्टिक और पेरिस के स्थान पर मिट्टी से बनी मूर्तियों का उपयोग किया जाये।
- मूर्ति निर्माण में रासायनिक रंगों के स्थान पर प्राकृतिक रंगों का उपयोग किया जाये।

नगरीय स्तर एवं राष्ट्रीय स्तर को पूर्ण ब्रह्मा एवं आरुणा के साथ मानते हुए पर्यावरण संरक्षण के इस पावन कार्य में आपका सहयोग अपेक्षित है।

क्षेत्रीय कार्यालय - म. प्र. प्रदूषण नियंत्रण बोर्ड
प्लॉट नं. 455/456, विजय नगर, जबलपुर (म. प्र.)
मुद्रक - मुकुल शिर्डी, प्रेम मंदिर, राहट राजन, बल्लभपुर/म.प्र. 473002

क्षेत्रीय कार्यालय
मध्य प्रदेश प्रदूषण नियंत्रण बोर्ड

मण्डलाध्यक्ष नागरीकों से पर्यावरण संरक्षण हेतु सहयोग की निम्न अपील

हमें ज्ञात है कि "जल है तो जीवन है" जल प्रकृति का एक प्रमुख घटक है। जिसको शुद्ध एवं अच्छा बनाये रखना प्रत्येक नागरीक का परम कर्तव्य है। जल को शुद्ध रखकर प्रकृति के संतुलन को बनाने में हम महत्वपूर्ण योगदान दे सकते हैं अतः म.प्र. प्रदूषण नियंत्रण बोर्ड आपकी गंभीर धन्यता एवं धर्म पूजा के पावन पर्व पर स्थापित होने वाली मूर्ति स्थापना के परिपेक्ष्य में केन्द्रीय प्रदूषण नियंत्रण बोर्ड द्वारा निर्धारित मार्गदर्शिका के अनुसार पूजन सामग्री, मूर्तियों के निर्माण एवं उनके विसर्जन के लिए विनम्र अपील करता है कि:-

- मूर्तियों का निर्माण पुराणों में उल्लेखानुसार प्राकृतिक पदार्थों के उपयोग जैसे मिट्टी आदि से करें।
- मूर्ति निर्माण में पक्की हुई मिट्टी, प्लास्टिक और पेरिस (पी.ओ.पी.) का उपयोग नहीं करें।
- मूर्तियों का कलर पैटिंग का कार्य केमिकल युक्त पेंट द्वारा नहीं करें। जिसमें खतरनाक भारी धातुएँ जैसे क्रोमियम, लेड आदि होने से नदी जल की गुणवत्ता एवं मानव जीवन पर दुष्प्रभाव होता है।
- मूर्तियों के पैटिंग हेतु जल में घुलनशील रंग को कि विपरीत ना हो, प्राकृतिक रंगों का उपयोग में लायें।
- मूर्तियों के पूजन हेतु उपयोग में लाये गये पुष्प, कपड़े तथा मूर्ति से निकाली गई धातु युक्त आभूषण आदि को मूर्ति विसर्जन के पूर्व अलग करें। इस प्रकार के जैव पदार्थ से नष्ट होने वाली सामग्री एवं जैव पदार्थ से नष्ट नहीं होने वाली सामग्री को प्रथम-पृथक एकत्रित किया जाकर उपयुक्त विधि से डिस्पोजल करें।
- मूर्ति विसर्जन के पूर्व प्रथम की गई जैव पदार्थ से नष्ट होने वाली सामग्री यथा फूल, पत्तें आदि को अलग कर खाद निर्माण हेतु निर्मित अलग पिट में डालें।
- मूर्ति विसर्जन के पूर्व प्रथम की गई जैव पदार्थ से नष्ट नहीं होने वाली सामग्री को अलग पिट में एकत्रित करें।

म.प्र. प्रदूषण नियंत्रण बोर्ड समस्त नागरिकों से पुनः अपील करता है कि पर्यावरण के मुख्य घटक जल, धूल, वायु, वनस्पति में प्राकृतिक संतुलन बनाने के लिए पर्यावरण को शुद्ध रखें तथा मूर्तियों का विसर्जन नियत स्थल पर करें, अधिक शोर वाले संयंत्रों तथा 40 माइक्रोन से कम मोटाई की प्रतिवर्धित पॉलिथीन थैलियों का उपयोग नहीं करें तथा इको-फ्रेंडली उत्पादों के उपयोग को प्रोत्साहित कर पर्यावरण संरक्षण में अपना योगदान देकर प्रदेश के पर्यावरण को और अधिक अच्छा बनाने में सहयोग प्रदान करें ताकि हम आने वाले पीढ़ी को बेहतर पर्यावरण सौंप सकें।

सहम्यवाद

जनहित में जारी : क्षेत्रीय कार्यालय, म.प्र. प्रदूषण नियंत्रण बोर्ड, 17 अरतपुरी, उज्जैन

नुकड़-नाटक से बताया पर्यावरण का महत्व

प्रदूषण बोर्ड ने बड़े पॉपुलर, किया जगह

जामरुण, रोवा। मूर्ति निर्माण एवं विसर्जन के दौरान केन्द्रीय प्रदूषण नियंत्रण बोर्ड को गाइडलाइन एवं म.प्र. प्रदूषण नियंत्रण बोर्ड, भोपाल के आदेश पर क्षेत्रीय कार्यालय रोवा के द्वारा मूर्ति विसर्जन के दौरान पर्यावरण की सुरक्षा, प्राकृतिक जलाशयों को प्रदूषण से बचाने एवं जल गुणवत्ता को कायम रखने हेतु विभिन्न जन-जागरूकता के कार्यक्रम जैसे नुकड़-नाटक शिक्षण संस्थाओं तथा आम जन से बैनर/पोस्टर के माध्यम से प्रचार-प्रसार किया जा रहा है। इस क्रम में शहर के तीन व्यन्जन मार्गस्थ स्थानों, जैसे सिस्मौर चौक, साईं मंदिर कोठी कम्पाउंड एवं बिक्रम गिरगाह पर नुकड़-नाटकों का आयोजन किया गया। जिसमें मूर्ति निर्माण व मूर्ति विसर्जन के दौरान लोगों से अपील की गई कि वे इको फ्रेंडली छोटे आकार की प्राकृतिक पदार्थों से निर्मित मूर्तियाँ स्थापित करें, तथा प्रथम करें कि मूर्तियों को घर में ही विसर्जन करें। नाटक के माध्यम से अपील की गई



कि वे रासायनिक रंगों का प्रयोग न करके प्राकृतिक रंग जैसे-हल्दी, कलर, गेरू, हल्दी, एवं खाने में उपयुक्त होने वाले रंगों का प्रयोग करें। इसके साथ ही लोगों को नगरीय निकायों द्वारा निर्धारित किये गये मूर्ति विसर्जन स्थल पर ही मूर्तियों को विसर्जन करने हेतु अपील की गई। नुकड़-नाटक को लोगों तक पहुंचाने में राकेश कुमार शुक्ल, रमजान मोहम्मद,

सचिन, कर्ण, दीपक पटेल तथा अन्य कलाकारों का विशेष योगदान रहा। क्षेत्रीय कार्यालय म.प्र. प्रदूषण नियंत्रण बोर्ड रोवा के डॉ. संजय मिश्रा, डॉ. शुभा माधुर, आरबी यादव, आरपी पटेल, डीके शुक्ला, नवीन दुबे, रमेश कुमार तिवारी द्वारा पर्यावरण संरक्षण हेतु विभिन्न स्थानों पर परामर्श के माध्यम से लोगों में जन-चेतना जगाने हेतु कार्य किया गया।

4.Distribution of Pamphlets



2.No idol immersion into river Ganga and its tributaries and on their banks.


- ✓ The local government setup temporary immersion kund for idol immersion on the bank of all the state's major rivers and ponds.




3. River banks and ghats should be cordoned off and barricaded to prevent any stray immersion of idols in the river or its banks.

- ✓ Barricading was installed on the main ghats of rivers to prevent idol immersion and posters / Pamphlets advising about it were also placed.

Barricading

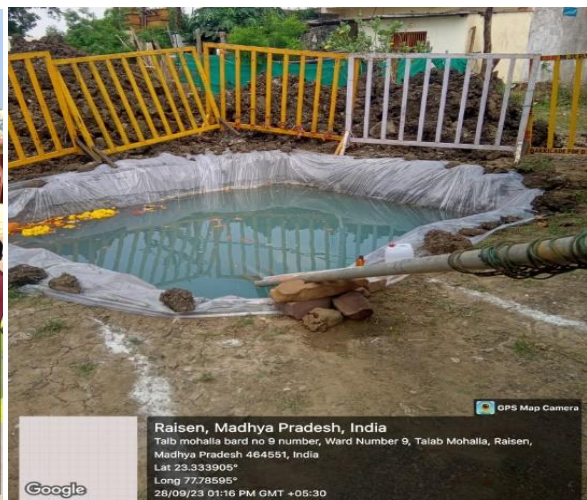

Posters / Pamphlets

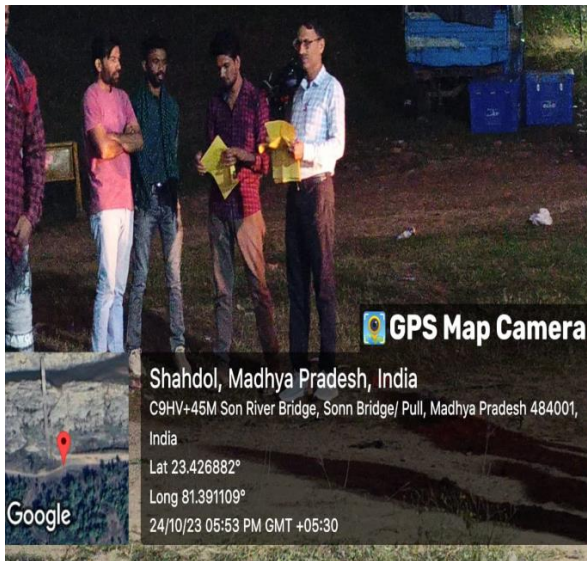


4. Adequate arrangements should be made for designated idol-immersion sites within municipal area or bank of river Ganga and its tributaries by constructing temporary confined ponds with removable synthetic liners at the bottom.

- ✓ The local government setup adequate arrangements of temporary/artificial pond for idol-immersion.

 कार्यालय नगर पालिक निगम, सतना (म.प्र.) Office of the Municipal Corporation, Satna (M.P.)		"Swami Vivekanand Bhawan" Infront of Gayatri Mandir, Diversion Road, SATNA-485001 Tel : 07672-228818, Fax-07672-224799 Email ID- commsatna@mpurban.gov.in	
क्रमांक /		/ न.पा.नि. / 2023	
		सतना, दिनांक - / 09 / 2023	
— आदेश —			
दिनांक 28.09.2022 को गणेश विसर्जन किया जाना है, एन.सी.टी. की गाईड लाइन के अनुसार प्रसिद्ध नदियों में विसर्जन नहीं किया जाना है। अतः नदियों के समीप विसर्जन स्थलों की समुचित व्यवस्था हेतु निम्न निर्देश जारी किये जाते हैं, संबंधित जन आदेश में सौंपे गये दायित्वों का निर्वहन पूरी तत्परता के साथ करेंगे। इस सम्पूर्ण व्यवस्था का समन्वय श्री भूपेन्द्र देव परमार उपायुक्त (वित्त) नगर पालिक निगम सतना द्वारा किया जाएगा।			
क्र.	नाम अधिकारी / कर्मचारी	पदनाम	सौंपा गया दायित्व
1	2	3	4
1.	श्री नागेन्द्र सिंह	प्र.कार्यपालन यंत्री	प्रतिवर्ष की भांति इस वर्ष भी गणेश विसर्जन स्थल पर प्रतिमा विसर्जन हेतु केंद्रीय प्रदूषण नियंत्रण बोर्ड नई दिल्ली द्वारा जारी निर्देशों के अनुक्रम में विसर्जन स्थल माधवगढ़ टमस नदी, सतना नदी एवं जीमनहट नदी पर पर्याप्त आयतन के कुण्डों का निर्माण कराया जाय।
2	श्री आर.पी.सिंह	प्र.कार्यपालन यंत्री	टैंकर के माध्यम से विसर्जन स्थल माधवगढ़ टमस नदी, सतना नदी एवं जीमनहट नदी में पेयजल की व्यवस्था करना।
3	श्री बृजेश मिश्रा श्री राजू राकेश श्री मो. लतीफ श्री मनीष पाण्डेय श्री राजेश कोल श्री अरूण बड़ौलिया	प्र.स्वच्छता अधि. प्र.सहायक अधि. स्वच्छता निरीक्षक स्वच्छता निरीक्षक स्वच्छता निरीक्षक	1. विसर्जन स्थल माधवगढ़ टमस नदी, सतना नदी एवं जीमनहट नदी में साफ-सफाई नूने की लाईन चलाना। विसर्जन स्थलों पर चार चार सफाई कामगार एवं एक उपस्वच्छता निरीक्षक की डियूटी लगाकर उनकी उपस्थिति सुनिश्चित करना।
4	श्री एस.डी.पाण्डेय श्री निखिल शुक्ला	सहायक आयुक्त मण्डार पाल	1. गणेश विसर्जन स्थल माधवगढ़ टमस नदी, सतना नदी एवं जीमनहट नदी में प्रकाश की निर्बाध व्यवस्था के लिए जनरेटर की व्यवस्था कराया जाना। 2. विसर्जन स्थलों पर टेंट एवं कुर्सियों की व्यवस्था कराया जाना।
5	श्री श्री शिवा सिंह श्री नारायण चतुर्वेदी	उपयंत्री विद्युत निरीक्षक	1. गणेश विसर्जन स्थल माधवगढ़ टमस नदी, सतना नदी एवं जीमनहट नदी में समुचित प्रकाश की व्यवस्था सुनिश्चित करना ताकि पूर्ण विसर्जन के दौरान किसी भी तरह की अशुभता न हो। 2. मण्डार शाखा द्वारा उपलब्ध कराये गये जनरेटर से विसर्जन स्थल में की गई विद्युत व्यवस्था को बनाये रखने हेतु को-पो लाईनमैनो की डियूटी प्रत्येक विसर्जन स्थल में लगाकर उनकी उपस्थिति सुनिश्चित कराया जाना।
6	श्री राम प्रताप सिंह	फायर ऑफिसर	दिनांक 28.09.2022 को गणेश विसर्जन के दिन कन्ट्रोल रूम में फायर विग्रेड की व्यवस्था कराया जाना।
यह आदेश जारी होने के साथ ही प्रभावशील होगा।			
		आयुक्त नगर पालिक निगम सतना (म.प्र.)	
प्र.क्रमांक: 199 / न.पा.नि. / 2023		(2)	
प्रतिलिपि:		सतना, दिनांक: 11 / 09 / 2023	
1. माननीय महापौर, नगर पालिक निगम सतना। 2. श्री भूपेन्द्र देव परमार उपायुक्त (वित्त), नगर पालिक निगम सतना। 3. श्री एस.डी.पाण्डेय, उपायुक्त, नगर पालिक निगम सतना। 4. श्री प्र.कार्यपालन यंत्री / सहायक यंत्री / उपयंत्री, नगर पालिक निगम सतना। 5. श्री बृजेश मिश्रा, प्र.स्वच्छता अधिकारी, नगर पालिक निगम सतना। 6. श्री राम प्रसाद सिंह, फायर ऑफिसर, नगर पालिक निगम सतना। 7. श्री अनिल श्रीवास्तव प्र.कार्यालय अधीक्षक, नगर पालिक निगम सतना। 8. श्री प्र.सहायक स्वच्छता अधिकारी / स्वच्छता निरीक्षक, नगर पालिक निगम सतना। 9. श्री निखिल शुक्ला, मण्डारपाल, नगर पालिक निगम सतना। 10. श्री नगर पालिक निगम सतना।			
		आयुक्त नगर पालिक निगम सतना (म.प्र.)	

- ✓ The Board staff at the immersion site informed the public about the immersion of idol in the artificial pond.

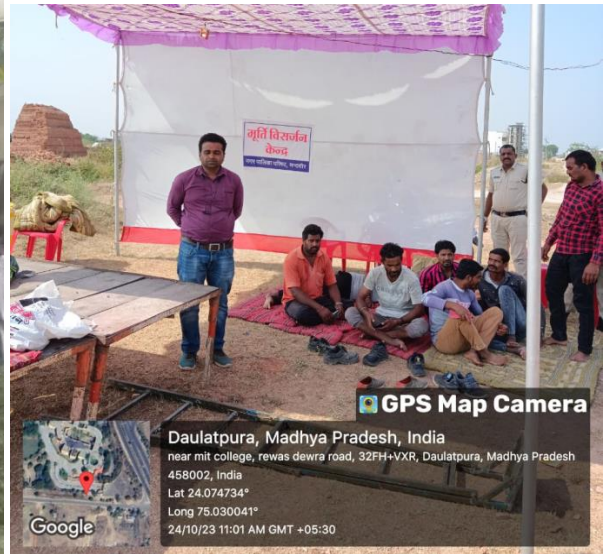




5. Sufficient numbers of separate bins/containers should be provided at designated idol-immersion sites for collection of flowers, garlands and decorating materials /clothing /metal items.

- ✓ The staff of the Municipal Corporation should establish an adequate numbers of separate bins/containers and vehicles for the collection of flowers, garlands and decorating materials /clothing /metal items.



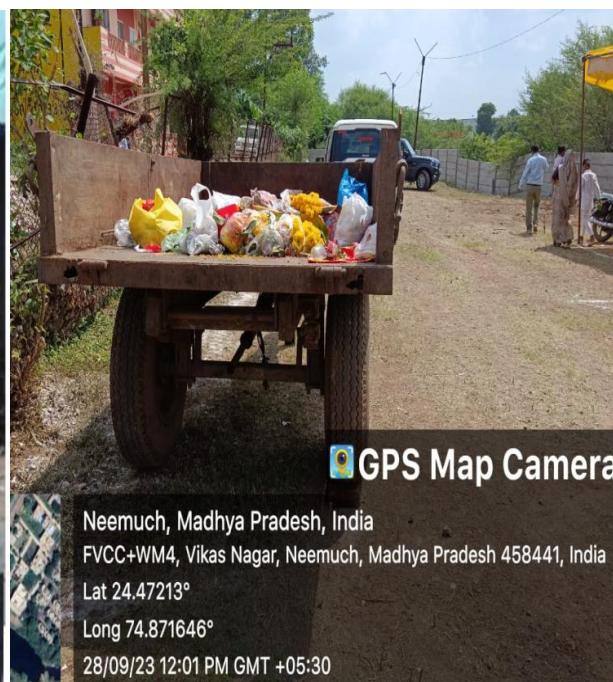

6. Separate bins/receptacles should be also provided at ghats on river Ganga and its tributaries for collection of flowers, garlands, decorating and materials/clothing/ metal items.

- ✓ Additionally, separate bins and containers were made available for the previously mentioned collecting of flowers, garlands, decorations and materials/clothing/ metal items from the bank of rivers.



7. Three bin system to be provided at all pooja pandals for proper segregation of biodegradable and non-biodegradable pooja refuse and other materials for ensuring efficient disposal.

- ✓ A three bin system has been set up in biodegradable and non-biodegradable pooja and other materials for ensuring efficient disposal.



8. Biodegradable pooja materials like flowers, garlands etc. were composted, while non-biodegradable materials like decorating materials (made of paper, plastic and clothing) and metal items etc. should be recycled, in an eco-friendly manner.

- ✓ Biodegradable pooja materials like flowers, garlands etc. were composted, while non-biodegradable materials such as decorating materials (made of paper, plastic and clothing) and metal items etc. were collected separately to be recycled, in an eco-friendly manner.

9.No pooja material to be disposed directly in the river.

- ✓ Posters were put up so that no pooja material should be disposed directly in the river.



10.Aco-ordination Committee comprising of District Administration officials, Municipal officials, Police, NGOs etc. may be set up for guiding

the public and pooja Committees for carrying out and immersion with no adverse effect to the environment.





- ✓ District Administration officials, Municipal officials, Police, NGOs etc. gave guidance for idol immersion.



11. Within 48 hrs. of the immersion of idol (Visarjan) the left-over material at all designated idol immersion sites within municipal area/ panchayat /

bank of river should be collected by the local bodies for disposal as per CPCB Guidelines.

- ✓ According to CPCB Guidelines, left-over material at designated idol immersion sites will be collected by the local bodies for disposal within 48 hrs.

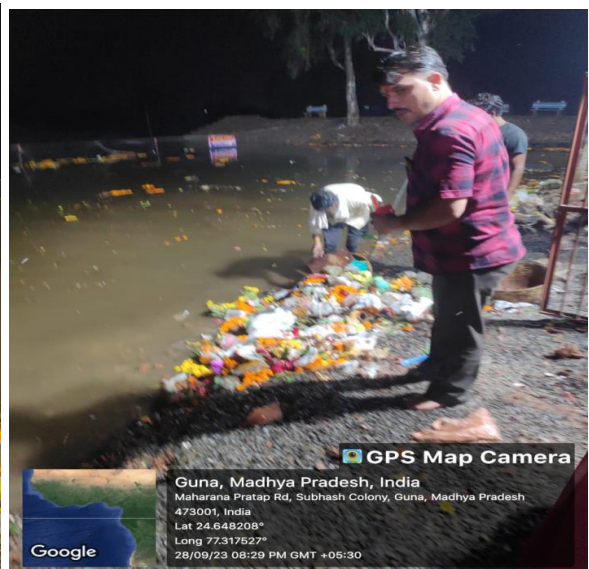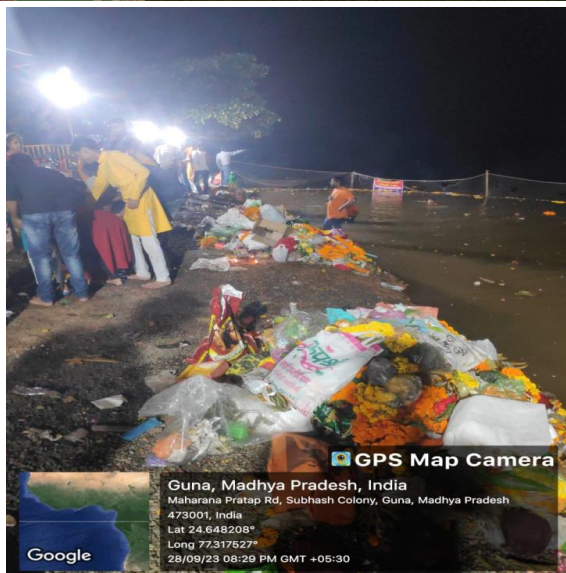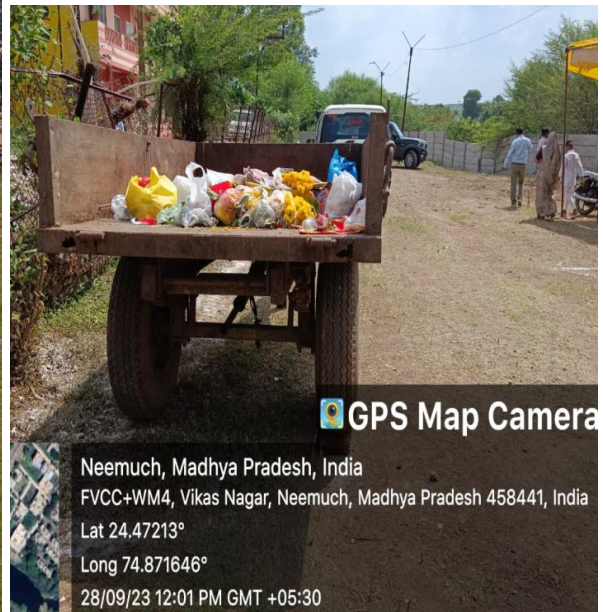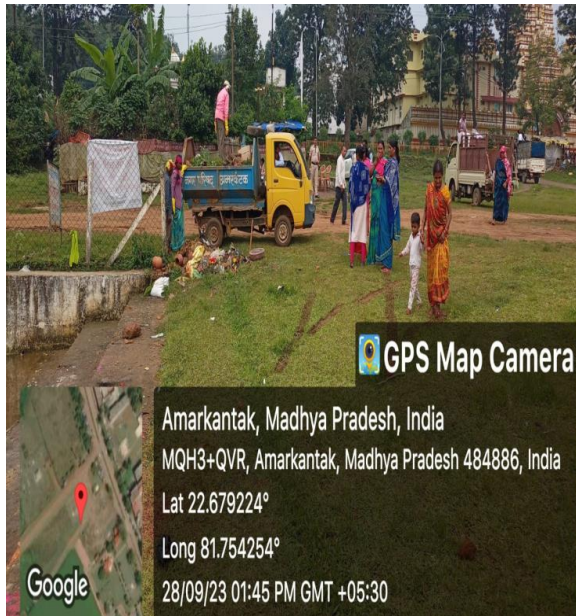



12. Notification of designated idol-immersion sites to pooja Samitis, mela authorities, general public through newspaper Advertisements and other means of information dissemination.

- ✓ Newspaper and other forms of media were used to inform pooja samite's and general public.

प्रतिमाओं का विसर्जन निर्धारित कुण्ड में ही किया जाय : निगमायुक्त

जागरण, रीवा। नगर पालिक निगम रीवा द्वारा श्रीगणेश जी की प्रतिमाओं के विसर्जन के लिए छतुरिहा घाट बिछिया एवं करहिया घाट में विसर्जन कुण्ड का निर्माण कराया गया है। जहां पर प्रतिमाओं का विसर्जन किये जाने की व्यवस्था बनाई गई है। निगमायुक्त संस्कृति जैन ने बताया कि शासन की गाइड लाइन के अनुसार बीहड़ नदी के बाबा घाट में किसी भी प्रकार की प्रतिमा का विसर्जन पूर्णतः प्रतिबंधित है। नेशनल ग्रीन ट्रिब्यूनल के निर्देशानुसार प्रशासन द्वारा निर्धारित स्थान पर ही प्रतिमाओं का विसर्जन किया जाना है। निगमायुक्त संस्कृति जैन ने शहरवासियों से अपील की है कि ग्रीन ट्रिब्यूनल के द्वारा निर्धारित गाइडलाइन अनुसार प्रतिमाओं का विसर्जन नगर पालिक निगम रीवा द्वारा निर्मित कराए गए विसर्जन कुण्ड में ही किया जाय। रात्रि में प्रतिमा विसर्जन में किसी प्रकार कठिनाई नहीं हो इसके लिए नगर निगम द्वारा हाईमास्ट लाइट लगवाई गई है।

मूर्ति निर्माण एवं विसर्जन के दिशा निर्देशों पर कार्यशाला संपन्न



एक्सप्रेस न्यूज कटनी। अर्जुन पैलिस सभागार में मूर्ति निर्माण एवं विसर्जन (गणेश उत्सव एवं दुर्गा उत्सव) के संबंध में एन. जी. टी. एवं सी. बी. सी. बी. द्वारा जारी दिशा निर्देशों के अनुपालन में एक दिवसीय कार्यशाला का आयोजन म.प्र. प्रदूषण नियंत्रण बोर्ड कटनी द्वारा किया गया। जिसमें जिला प्रशासन की ओर से श्रीमती संस्कृति शर्मा जूनियर कलेक्टर श्रीमती ज्योति सिंह, महाप्रबंधक जिला उद्योग केन्द्र - कटनी तथा नगर पालिक निगम कटनी से के.पी. शर्मा कार्यपालन यंत्री एवं शहर के गणमान्य नागरिक, नगरीय निकायों के प्रतिनिधि, स्थानीय संस्थाओं के प्रतिनिधि एवं शैक्षणिक संस्थान आर. एस. मेमोरियल के छात्र - छात्राएं, ओम साईं एन. जी.ओ. रूप से कार्यकर्ता एवं स्वच्छता ब्रांड एम्बेस्टर आशुतोष मनके गणेश उत्सव एवं दुर्गा उत्सव समितियों के प्रतिनिधि, मूर्तिकार सामाजिक संस्थाओं के प्रतिनिधि एवं कार्यालय के समस्त अधिकारी कर्मचारी उपस्थित रहे। कार्यक्रम में सर्वप्रथम सुधांशु तिवारी सहायक यंत्री द्वारा आये हुये



अतिथियों का स्वागत किया गया तथा माँ सरस्वती के समक्ष मुख्य अतिथि द्वारा दीप प्रज्वलित कर कार्यक्रम का शुभारंभ किया गया। क्षेत्रीय कार्यालय म.प्र. प्रदूषण नियंत्रण बोर्ड के सुधांशु तिवारी सहायक यंत्री द्वारा मूर्ति निर्माण एवं विसर्जन के संबंध में एन. जी. टी. एवं सी.पी.सी.बी. द्वारा जारी दिशा निर्देशों के संबंध में विस्तृत जानकारी आम जन को दी गई तथा कहा गया कि मूर्तियों के निर्माण में मिट्टी एवं प्राकृतिक रंगों के उपयोग किये जाने एवं पी.ओ.पी. तथा खतरनाक रसायनों के उपयोग को पूर्णतः प्रतिबंधित किये जाने एवं छोटी मूर्तियों के निर्माण करने के साथ मूर्ति विसर्जन नदी तालाब में न किया जावे। कार्यक्रम में उपस्थित जिला प्रशासन के प्रतिनिधि संयुक्त कलेक्टर श्रीमती संस्कृति शर्मा द्वारा कहा गया कि एन.जी.टी. एवं सी.पी.सी.बी. के द्वारा जारी दिशा निर्देश के पालनाथ मूर्तियों के निर्माण में मिट्टी एवं प्राकृतिक रंगों के उपयोग किये जाने एवं पी.ओ.पी. तथा खतरनाक रसायनों के उपयोग को पूर्णतः प्रतिबंधित किये जाने एवं छोटी मूर्तियों के निर्माण करने के साथ मूर्ति विसर्जन



नदी तालाब में न किया जाये बल्कि शासन एवं स्थानीय निकायों द्वारा चिन्हित स्थानों पर ही किये जाने की विस्तृत जानकारी दी गई। जिला उद्योग केन्द्र महाप्रबंधक श्रीमती ज्योति सिंह द्वारा भी उपरोक्त वक्ता द्वारा कही गई बातों का समर्थन किया गया, साथ ही उपस्थित विशिष्ट जनों द्वारा समीनार परिपर में आर.एस. मेमोरियल के बच्चों द्वारा बनाई गई मिट्टी से गणेश मूर्ति का अवलोकन किया गया तथा उपरोक्त मूर्तियों की भूर भूर प्रशंसा की गई। कार्यशाला में उपस्थित मूर्तिकारों द्वारा अपने उद्बोधन में बताया गया कि हम मूर्ति निर्माण में मिट्टी एवं प्राकृतिक रंगों का उपयोग कर रहे हैं। उपरोक्त समीनार को सफल बनाने में क्षेत्रीय कार्यालय म.प्र. प्रदूषण नियंत्रण बोर्ड के सुधांशु तिवारी, सहायक यंत्री आर. पी. शुक्ला, रसायनज्ञ प्रतीक ज्योतिषी, कास्ट्रैक्ट इंजीनियर, गणेश प्रसाद पाठक सुधीर कुमार द्विवेदी, भाग्यश्री सुखने राधे शरण दुबे जे.पी. शुक्ला उपस्थित रहे। श्री तिवारी द्वारा आभार व्यक्त कर कार्यशाला समाप्त की गई।

बच्चों द्वारा बनाई गई मिट्टी से गणेश मूर्ति का किया अवलोकन

मूर्ति निर्माण एवं विसर्जन के संबंध में कार्यशाला

कटनी, यशपारता। अर्जुन पैलिस सभागार में मूर्ति निर्माण एवं विसर्जन (गणेश उत्सव एवं दुर्गा उत्सव) के संबंध में एन.जी.टी. एवं सी.पी.सी.बी. द्वारा जारी दिशा निर्देशों के अनुपालन में एक दिवसीय कार्यशाला का आयोजन म.प्र. प्रदूषण नियंत्रण बोर्ड कटनी द्वारा किया गया। जिसमें जिला प्रशासन की ओर से श्रीमती संस्कृति शर्मा, जूनियर कलेक्टर श्रीमती ज्योति सिंह, तथा के.पी. शर्मा, एवं शहर के गणमान्य नागरिक, नगरीय निकायों के प्रतिनिधि, स्थानीय संस्थाओं के प्रतिनिधि, एवं शैक्षणिक संस्थान आर.एस.मेमोरियल के छात्र-छात्राएं, ओम साईं एन.जी.ओ. रूप से कार्यकर्ता एवं स्वच्छता ब्रांड एम्बेस्टर आशुतोष मनके, गणेश उत्सव एवं दुर्गा उत्सव समितियों के प्रतिनिधि, मूर्तिकार सामाजिक संस्थाओं के प्रतिनिधि एवं कार्यालय के समस्त अधिकारी कर्मचारी उपस्थित रहे। कार्यक्रम में सर्वप्रथम सुधांशु तिवारी सहायक यंत्री द्वारा आये हुये अतिथियों का स्वागत किया गया तथा माँ सरस्वती के समक्ष मुख्य अतिथि द्वारा दीप प्रज्वलित कर कार्यक्रम का शुभारंभ किया गया। क्षेत्रीय कार्यालय म.प्र. प्रदूषण नियंत्रण बोर्ड के सुधांशु तिवारी सहायक यंत्री आर. पी. शुक्ला, रसायनज्ञ प्रतीक ज्योतिषी, कास्ट्रैक्ट इंजीनियर, गणेश प्रसाद पाठक सुधीर कुमार द्विवेदी, भाग्यश्री सुखने राधे शरण दुबे जे.पी. शुक्ला उपस्थित रहे। श्री तिवारी द्वारा आभार व्यक्त कर कार्यशाला समाप्त की गई।

सिंगरौली


जबलपुर, शुक्रवार 15 सितंबर 2023 4

प्रदूषण बोर्ड ने प्रदूषण नियंत्रण रखने के लिए मूर्तिकारों को मूर्ति बनाने के दिए निर्देश

प्रदूषण बोर्ड के क्षेत्रीय अधिकारी सिंगरौली जिला प्रशासन के माधव सिंह ने 13 सितंबर 2023 को एक दिवसीय कार्यशाला का आयोजन क्षेत्रीय कार्यालय मध्य प्रदेश प्रदूषण नियंत्रण बोर्ड भुवनेश्वर नगर सिंगरौली में आयोजित किया गया जिसमें सिंगरौली जिले के सभी मूर्तिकार उपस्थित हुए जिनमें गणेश जी दुर्गा जी की मूर्ति का निर्माण केवल मिट्टी या अन्य प्राकृतिक कच्चे पदार्थों, इको फेंडर तथा प्राकृतिक रंगों से छोटी आकार की मूर्ति बनाने हेतु दिशा निर्देश दिया गया तथा मूर्ति निर्माण में प्लास्टर ऑफ पेरिस का उपयोग न किए जाने की जानकारी से डॉक्टर राहुल द्विवेदी वैज्ञानिक द्वारा कार्यशाला में अवगत कराया गया जिससे यह बात भी विशेष रूप से अवगत कराई गई की गणेश एवं दुर्गा जी की मूर्ति का विसर्जन केवल विसर्जन कुंड में ही किया जावे। कार्यशाला में समस्त अधिकारी कर्मचारी उपस्थित रहे जिसमें शक्ते, टी पी साकेत, मनोज सिंह, सूरज, मूर्तिकार तथा अन्य लोग उपस्थित रहे।


13. Public and pooja Samite's be educated regarding ill effects of idol immersion in rivers and waterbodies through mass Awareness Program's. Messages should be constantly played by pooja samitis for information of devotees regarding the arrangements of designated idol-immersion sites.

- ✓ Through public awareness programs, we have informed the general public as well as pooja samite's about the negative impacts of idol immersion in rivers and other water bodies. The pooja samite's informed the devotees up to date on the location of the idol-immersion sites.

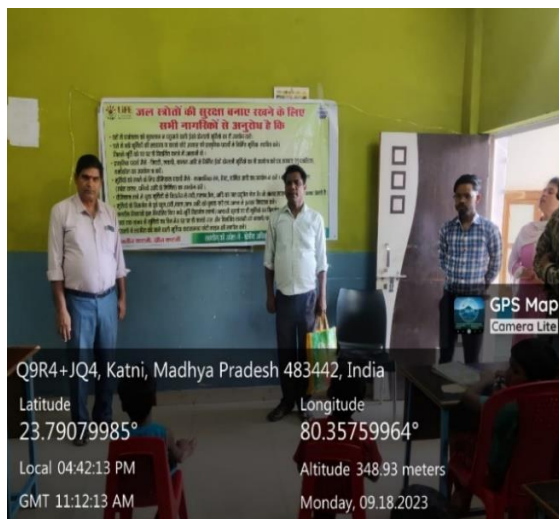

14. Adequate numbers of hoarding boards/banners to be placed at various locations within municipal area and near pooja pandals with DO'S and DON'T'S in respect of idol immersion during festivals. Similarly hoarding boards/banners related to ban of idol immersion in rivers/water bodies to be placed at designated idol-immersion sites and important Ghats on River Ganga and its tributaries.

- ✓ An adequate numbers of hoarding boards/banners were put up near the puja pandals, idol immersion site and at important ghats.

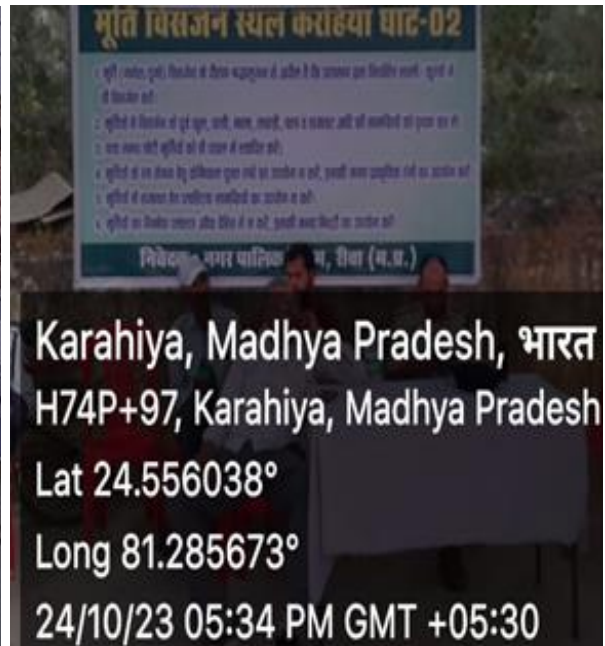

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Khatlapura Visarjanganhat, Bhopal.****R.O. Bhopal**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	6.98	7.63	8.08
2	Total Solids	408	394	366
3	Dissolved Solids	352	348	314
4	suspended-solids	56	46	52
5	D.Oxygen	6.4	6.1	7.8
6	BOD	2.4	2.8	11.2
7	COD	20	20	78.4
8	Turbidity	9.1	3.3	8.6
9	Conductivity	478.4	544	486.9
10	Chromium	BDL	—	BDL
11	Lead	BDL	—	BDL
12	Zinc	0.011	—	0.019
13	Copper	BDL	—	0.026

Water Monitoring Report during Ganesha IDOL Immersion**Sant Hirdaram Visarjankund, Bairagarh, Bhopal.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.71	7.37	7.2
2	Total Solids	818	832	950
3	Dissolved Solids	794	802	860
4	suspended-solids	24	30	90
5	D.Oxygen	5.6	4.5	0
6	BOD	3.8	4.2	10
7	COD	30	40	60
8	Turbidity	4.3	4.3	29.7
9	Conductivity	1190	1222	1447
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.101	BDL
12	Zinc	0.238	0.689	0.023
13	Copper	BDL	0.069	0.019

Water Monitoring Report during Ganesha IDOL Immersion**Premura Visarjanganhat, Bhopal.**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.72	8.53	7.44
2	Total Solids	386	216	270
3	Dissolved Solids	338	178	225
4	suspended-solids	48	38	45
5	D.Oxygen	6.2	6.7	6.5
6	BOD	1.3	1.5	2
7	COD	10	10	20
8	Turbidity	8.9	3.2	5.3
9	Conductivity	463.2	294	345
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.076	BDL
12	Zinc	0.009	0.0183	0.015
13	Copper	BDL	0.066	0.025

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Rani kamlapati,kamla park,murti visarjan kund,Bhopal.****R.O. Bhopal**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.65	8.35	8.07
2	Total Solids	300	385	368
3	Dissolved Solids	268	340	312
4	suspended-solids	32	45	56
5	D.Oxygen	6.6	5.8	9.5
6	BOD	4.2	4.4	9.2
7	COD	30	40	68.6
8	Turbidity	5.1	1.5	8.1
9	Conductivity	402.1	546	488
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.06	BDL
12	Zinc	0.012	0.066	0.01
13	Copper	BDL	0.074	0.019

Water Monitoring Report during Ganesha IDOL Immersion**Hathaikheda visarjan kund, Bhopal.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.1	8.92	8.01
2	Total Solids	374	402	420
3	Dissolved Solids	318	332	338
4	suspended-solids	56	70	82
5	D.Oxygen	7.9	6.5	5.1
6	BOD	2.5	6	10.8
7	COD	30	60	88.2
8	Turbidity	41.3	84	37.6
9	Conductivity	527.6	553	522.4
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.08	BDL
12	Zinc	0.026	0.077	0.008
13	Copper	BDL	0.105	0.031

Water Monitoring Report during Ganesha IDOL Immersion**Maalikhedi visarjan kund, Bhopal.**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.65	7.81	7.11
2	Total Solids	348	365	800
3	Dissolved Solids	326	340	514
4	suspended-solids	22	25	286
5	D.Oxygen	7.5	7	3.2
6	BOD	1.6	1.8	16.8
7	COD	10	10	127.4
8	Turbidity	1.4	1.8	42.9
9	Conductivity	510.6	542	792.7
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.145	BDL
12	Zinc	0.024	0.089	0.011
13	Copper	BDL	0.111	0.026

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Murti visarjan ghat at Shahpura lake,Bhopal.****R.O. Bhopal**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.32	7.36	7.76
2	Total Solids	432	480	604
3	Dissolved Solids	394	428	528
4	suspended-solids	38	52	76
5	D.Oxygen	5.9	5.2	5
6	BOD	6.4	8.4	10.4
7	COD	40	59.28	68.6
8	Turbidity	10.2	12.1	20.3
9	Conductivity	622.1	647.8	813.6
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	0.009	0.021	0.025
13	Copper	BDL	BDL	0.078

Water Monitoring Report during Ganesha IDOL Immersion**Murti visarjan Kund near Town Hall ,Sehore**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.42	7.66	7.83
2	Total Solids	400	436	502
3	Dissolved Solids	374	396	432
4	suspended-solids	26	40	70
5	D.Oxygen	6.4	6.7	5
6	BOD	1.4	1.9	3.2
7	COD	10	10	50
8	Turbidity	11.6	1.4	6.2
9	Conductivity	734.1	642	689
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.089	BDL
12	Zinc	BDL	0.033	0.018
13	Copper	BDL	BDL	0.022

Water Monitoring Report during Ganesha IDOL Immersion**Murti visarjan Kund Rajgarh**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	8.06	7.75	7.76
2	Total Solids	202	375	390
3	Dissolved Solids	176	340	345
4	suspended-solids	26	35	45
5	D.Oxygen	7.7	6	4.5
6	BOD	0.6	2.9	3
7	COD	17.84	20	20
8	Turbidity	15.6	1.3	5.8
9	Conductivity	340.8	535	556
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.08	BDL
12	Zinc	0.023	0.044	0.017
13	Copper	BDL	BDL	0.018

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Temporary kund Janki near Charantirthghat, Vidisha.****R.O. Bhopal**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.61	7.8	7.84
2	Total Solids	328	344	375
3	Dissolved Solids	294	302	317
4	suspended-solids	34	42	58
5	D.Oxygen	8.7	6.7	6.6
6	BOD	1.5	1.7	1.9
7	COD	10	10	20
8	Turbidity	3.3	2.4	5.9
9	Conductivity	494.4	494	601
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	0.086	BDL
12	Zinc	0.025	0.079	0.015
13	Copper	BDL	0.057	0.018

Water Monitoring Report during Ganesha IDOL Immersion**Jawahar Tekri Indore****R.O. Indore**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.63	7.053	7.7
2	Total Solids	316	416	428
3	Dissolved Solids	302	392	401
4	D.Oxygen	6.8	6.7	6.3
5	BOD	0.8	2.2	2.4
6	COD	8.71	35.81	40
7	Turbidity	1.8	14.3	16.2
8	Conductivity	489	595.2	617
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	—	—	—
12	Copper	—	—	—

Water Monitoring Report during Ganesha IDOL Immersion**Padam kund of idol-immersion at khandwa.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.06	7.15	7.52
2	Total Solids	450	629	918
3	Dissolved Solids	437	600	886
4	D.Oxygen	6.6	7.9	3.8
5	BOD	1.2	2.8	10
6	COD	15	40.65	45
7	Turbidity	0.8	22.9	38.8
8	Conductivity	705	906.2	1341.8
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.02	0.021

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Temporary Kund water of idol immersion,at Maheshwar ,khargone.****R.O. Indore**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.89	7.84	7.35
2	Total Solids	211	363	1061
3	Dissolved Solids	194	330	996
4	D.Oxygen	6.9	6	4.7
5	BOD	1	1.4	20
6	COD	18.39	37.75	60
7	Turbidity	7.9	13.7	40.4
8	Conductivity	305	500	1424.12
9	Chromium	ND	ND	0.26
10	Lead	ND	ND	0
11	Zinc	ND	ND	0
12	Copper	ND	0.15	0.18

Water Monitoring Report during Ganesha IDOL Immersion**Temporary kund water at rajghat ,Badwani.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.6	7.63	7.73
2	Total Solids	206	373	450
3	Dissolved Solids	185	325	432
4	D.Oxygen	8	7.5	5.9
5	BOD	0.8	1.2	2
6	COD	14.52	22.26	24
7	Turbidity	4.7	32.5	21.2
8	Conductivity	296	491	660.09
9	Chromium	ND	0.11	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.01	ND

Water Monitoring Report during Ganesha IDOL Immersion**Temporary Kund near River Narmada at Mortakka,khargone.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
	pH	7.56	7.6	7.72
2	Total Solids	287	447	697
3	Dissolved Solids	269	414	660
4	D.Oxygen	7.3	5.6	7.2
5	BOD	1.1	1.4	2.6
6	COD	17.42	24.2	28
7	Turbidity	4.1	13.7	34.4
8	Conductivity	333.49	628.1	1003
9	Chromium	ND	0.002	ND
10	Lead	ND	ND	ND
11	Zinc	ND	0.02	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Kund near River narmada at Brahmpuri ghat Omkareshwar****R.O. Indore**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.5	7.47	7.24
2	Total Solids	300	1178	1195
3	Dissolved Solids	287	1106	1125
4	D.Oxygen	6.7	3.9	2.2
5	BOD	1.4	2.8	3.6
6	COD	22.26	42.59	30
7	Turbidity	18.7	34.1	24.5
8	Conductivity	456.82	1676.9	1706.1
9	Chromium	ND	0.02	0.022
10	Lead	ND	ND	ND
11	Zinc	ND	0.5	0.53
12	Copper	ND	0.11	0.14

Water Monitoring Report during Ganesha IDOL Immersion**Renuka Jheel, Burhanpur.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.62	7.3	7.99
2	Total Solids	800	894	1150
3	Dissolved Solids	785	854	1100
4	D.Oxygen	6.8	6.8	3.2
5	BOD	2	3.2	12
6	COD	27.84	47.43	60
7	Turbidity	31.47	24.8	27.5
8	Conductivity	1119.9	1295.9	1506
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Temporary Idol immersion kund near River Kunda, K**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.76	7.81	7.61
2	Total Solids	289	474	339
3	Dissolved Solids	275	433	324
4	D.Oxygen	5.7	2.5	6.2
5	BOD	1.4	3.2	1.6
6	COD	20.32	64.85	16
7	Turbidity	6.8	23	8.9
8	Conductivity	439	658	492.22
9	Chromium	ND	0.1	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.02	ND

Ganesh Idol Immersion**YEAR -2023****R.O. Indore****Water Monitoring Report during Ganesha IDOL Immersion****Idol immersion kund water at near River Anas , Jhabua.****R.O.Dhar**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.62	7.76	7.88
2	Total Solids	277	427	642
3	Dissolved Solids	264	396	620
4	D.Oxygen	7.6	6.6	4.2
5	BOD	1.4	2	2.2
6	COD	15.48	21.29	30
7	Turbidity	7.6	15.5	25.6
8	Conductivity	340	525	998
9	Chromium	ND	0.1	0.014
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Kund water of Idol Immersion near water filtration plant, Dhar.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.77	7.72	7.79
2	Total Solids	192	301	310
3	Dissolved Solids	182	283	290
4	D.Oxygen	5.8	4.1	4
5	BOD	1	1.4	3.8
6	COD	16.45	26.13	18
7	Turbidity	3.5	10.3	20.1
8	Conductivity	290	329	460
9	Chromium	ND	0.5	0.53
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.1	0.12

Water Monitoring Report during Ganesha IDOL Immersion**Bavdi water at Dharampuri,dhar**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.86	7.79	6.9
2	Total Solids	202	354	645
3	Dissolved Solids	187	328	608
4	D.Oxygen	4.4	3	3
5	BOD	1.2	1.6	8
6	COD	24.2	33.88	40
7	Turbidity	4.5	5.5	8.9
8	Conductivity	299	499	906
9	Chromium	ND	ND	0.26
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.2	ND

Ganesh Idol Immersion**YEAR -2023****R.O.Dhar****Water Monitoring Report during Ganesha IDOL Immersion
kund water near sanjay jalashay,pithampur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.91	7.85	7.44
2	Total Solids	273	303	297
3	Dissolved Solids	264	289	285
4	D.Oxygen	7.4	6.7	6
5	BOD	1	1.4	1.8
6	COD	14.52	22.26	24
7	Turbidity	3.6	14.6	8
8	Conductivity	361.29	438	431.49
9	Chromium	ND	0.2	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	copper	ND	0.14	ND

Ganesh Idol Immersion**YEAR -2023****R.O.Dhar****Water Monitoring Report during Ganesha IDOL Immersion
kund water near bagdoon talab ,pithampur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.9	7.83	7.6
2	Total Solids	487	993	828
3	Dissolved Solids	472	958	800
4	D.Oxygen	5.9	4	4.4
5	BOD	1.4	2	14
6	COD	18.39	31.94	70
7	Turbidity	9.7	23.5	20.1
8	Conductivity	750	1452	1280
9	Chromium	ND	0.24	ND
10	Lead	ND	ND	ND
11	Zinc	—	—	ND
12	copper	ND	0.16	ND

Water Monitoring Report during Ganesha IDOL Immersion**Mishri talab visarjan kund, Raisen.****R.O. Mandideep**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	6.76	8.14	8.18
2	Total Solids	—	—	234
3	Dissolved Solids	134	378	206
4	D.Oxygen	8.2	3.7	7.7
5	BOD	1	4.1	1.6
6	COD	9.8	39.2	20
7	Turbidity	—	—	6.7
8	Conductivity	196	558	311
9	Chromium	BDL	BDL	BDL
10	Lead	0.24	0.73	0.14
11	Zinc	0.09	0.05	0.04
12	Copper	0.097	0.025	0.018

Ganesh Idol Immersion**YEAR -2023****R.O.Dhar****Water Monitoring Report during Ganesha IDOL Immersion****Visarjan kund Jhiriya Ghat ,near mahavir nagar, Mandideep.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	6.84	6.88	6.67
2	Total Solids	—	—	—
3	Dissolved Solids	256	454	544
4	D.Oxygen	7.2	3.4	2.6
5	BOD	1.7	4.4	5.1
6	COD	19.6	39.2	49
7	Turbidity	6.2	22.8	24.7
8	Conductivity	375	749	898
9	Chromium	BDL	BDL	0.04
10	Lead	0.24	0.26	0.18
11	Zinc	0.072	0.09	0.06
12	Copper	0.068	0.103	0.025

Water Monitoring Report during Ganesha IDOL Immersion**Herbal park visarjan kund, Hoshangabad.****R.O. Mandideep**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.23	7.34	7.73
2	Total Solids			
3	Dissolved Solids	168	616	658
4	D.Oxygen	7.7	3.6	2.4
5	BOD	1.3	5.4	6.2
6	COD	19.6	49	58.8
7	Turbidity	5.8	27.2	31.8
8	Conductivity	244	1032	1084
9	Chromium	BDL	BDL	BDL
10	Lead	0.11	0.21	BDL
11	Zinc	0.08	0.068	0.019
12	Copper	0.09	0.09	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Ajnal,Harda, Mandideep.,Gupteshwar temple.**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	8.39	6.87	6.63
2	Total Solids			
3	Dissolved Solids	196	592	624
4	D.Oxygen	7.4	3.8	3.1
5	BOD	1.4	4.8	5.6
6	COD	19.6	39.2	49
7	Turbidity	5.9	24.7	28.3
8	Conductivity	294	921	962
9	Chromium	BDL	BDL	BDL
10	Lead	0.19	0.3	0.19
11	Zinc	0.38	0.08	0.03
12	Copper	0.22	0.067	BDL

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Visarjan kund near Richan river, Raisen****R.O. Mandideep**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.24	6.96	7.54
2	Total Solids	—	—	—
3	Dissolved Solids	214	422	308
4	D.Oxygen	7.3	3.5	4.3
5	BOD	1.6	4.2	4
6	COD	19.6	39.2	29.4
7	Turbidity	6	21.8	21.4
8	Conductivity	312	694	492
9	Chromium	BDL	BDL	BDL
10	Lead	0.18	0.3	0.1
11	Zinc	0.08	0.146	0.02
12	Copper	0.104	0.18	BDL

Water Monitoring Report during Ganesha IDOL Immersion**Badokhar Talab, Morena.****R.O. Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.71	7.64
2	Total Solids	735	735	737
3	Dissolved Solids	660	650	670
4	D.Oxygen	7.2	7	7.1
5	BOD	2.1	2.1	2.2
6	COD	22	26	23
7	Turbidity	5	6	6
8	Conductivity	1056	1040	1072
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Kwari River ,Bhind ,phoof.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.6	7.2	7.71
2	Total Solids	350	360	360
3	Dissolved Solids	316	324	328
4	D.Oxygen	7.6	7.1	32
5	BOD	2.3	2.4	2.4
6	COD	34	36	36
7	Turbidity	2	2	2
8	Conductivity	490	510	510
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Jaderua Dam Gwalior.****R.O. Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.67	7.4	7.68
2	Total Solids	795	380	798
3	Dissolved Solids	710	340	720
4	D.Oxygen	7.1	6.8	7
5	BOD	2.2	2.3	2.1
6	COD	24	29	25
7	Turbidity	6	2	7
8	Conductivity	1136	530	1152
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Ganesha IDOL Immersion**Gauri Sarover, Bhind.****R.O. Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.1	7.64
2	Total Solids	320	370	330
3	Dissolved Solids	284	330	292
4	D.Oxygen	7.5	6.9	38
5	BOD	2.1	2.2	2.2
6	COD	25	30	26
7	Turbidity	2	2	3
8	Conductivity	450	520	450
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Sagar Taal, Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.72	7.6	7.74
2	Total Solids	743	360	748
3	Dissolved Solids	670	322	680
4	D.Oxygen	7.2	6.8	7.1
5	BOD	2.1	2.3	2.2
6	COD	23	28	24
7	Turbidity	6	3	7
8	Conductivity	1060	505	1088
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Ganesh Idol Immersion**YEAR -2023****R.O. Gwalior****Water Monitoring Report during Ganesha IDOL Immersion****Katora Taal, Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.64	7.5	7.65
2	Total Solids	687	340	705
3	Dissolved Solids	630	304	640
4	D.Oxygen	7.1	6.9	7
5	BOD	2	2.1	2.1
6	COD	22	26	25
7	Turbidity	4	2	5
8	Conductivity	1008	480	1024
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Lala Ka Taal, Datia.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.38	7.46	7.4
2	Total Solids	458	578	456
3	Dissolved Solids	390	500	384
4	D.Oxygen	68	7.2	7
5	BOD	2.2	2.4	2.2
6	COD	38	46	38.04
7	Turbidity	2.4	2.6	2.4
8	Conductivity	600	770	590
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Sita Sagar, Datia.****R.O. Gwalior**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.23	7.48	7.4
2	Total Solids	456	625	547
3	Dissolved Solids	378	536	462
4	D.Oxygen	7.2	7.4	7.2
5	BOD	2.4	2.6	2.4
6	COD	48	54	48
7	Turbidity	2.2	2.4	2.2
8	Conductivity	250	825	710
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****R.O. Gwalior****Water Monitoring Report during Ganesha IDOL Immersion****Karan Sagar, Datia.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.25	7.23	7.2
2	Total Solids	450	748	556
3	Dissolved Solids	400	660	474
4	D.Oxygen	50	7.2	7
5	BOD	20	2.4	2.2
6	COD	77	46	38
7	Turbidity	2	2.2	2
8	Conductivity	615	1020	730
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Chonda pool morena**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.67	7.56
2	Total Solids	410	386	430
3	Dissolved Solids	380	330	398
4	D.Oxygen	7	7.1	32
5	BOD	2.2	2	2.2
6	COD	26	26	28
7	Turbidity	3	3	3
8	Conductivity	590	528	610
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Pandit ghat , Sheopur.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.2	7.33	7.13
2	Total Solids	400	488	452
3	Dissolved Solids	350	400	375
4	D.Oxygen	50	88	7
5	BOD	2	2.2	2
6	COD	28	38	48
7	Turbidity	2.2	2.4	2.2
8	Conductivity	540	620	580
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Chambal river near khachroud road, chamunda mata mandir, Nagda.****R. O. Ujjain**

S. No.	Parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.35	8.16	8.42
2	Total Solids	484	504	574
3	Dissolved Solids	472	486	562
4	D.Oxygen	7.6	7.2	7.4
5	BOD	2.4	2.2	2
6	COD	20	24	18
7	Turbidity	4.3	8.2	3.6
8	Conductivity	542	605	704
9	Chromium	0.004	0.006	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**River Kshipra at Kaliyadeh palace, Ujjain**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.11	7.64	7.69
2	Total Solids	476	510	482
3	Dissolved Solids	460	492	470
4	D.Oxygen	7.4	7.1	7.3
5	BOD	8	9	9
6	COD	24	28	25
7	Turbidity	8.4	11.7	6.2
8	Conductivity	658	710	672
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Parshukheddi Talab at Agar Malwa.****R. O. Ujjain**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.32	7.19	7.34
2	Total Solids	378	394	384
3	Dissolved Solids	364	376	368
4	D.Oxygen	7.3	7.1	7.2
5	BOD	2.4	2.6	2
6	COD	12	16	14
7	Turbidity	6.7	10.2	9.1
8	Conductivity	518	526	527
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2025****R. O. Ujjain****Water Monitoring Report during Ganesha IDOL Immersion****Shail Mining Multanpura, Mandsaur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.62	7.35	7.77
2	Total Solids	572	628	580
7	Dissolved Solids	562	614	568
4	D.Oxygen	5.8	5.2	5.4
5	BOD	1.6	2.4	2
6	COD	12	16	13
7	Turbidity	6.9	11.2	8.4
8	Conductivity	799	877	812
9	Chromium	ND	0.002	0.002
10	Lead	ND	ND	ND
11	Zinc	ND	0.001	0.004
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Pond water near Sanjeevni nallah,Neemuch.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.92	7.11	DRY
2	Total Solids	784	918	—
7	Dissolved Solids	774	898	—
4	D.Oxygen	6.9	6.1	—
5	BOD	1.6	2.2	—
6	COD	14	17	—
7	Turbidity	12.6	18.2	—
8	Conductivity	1106	1142	—
9	Chromium	ND	ND	—
10	Lead	ND	ND	—
11	Zinc	ND	ND	—
12	Copper	ND	ND	—

Ganesh Idol Immersion**YEAR -2023****R. O. Ujjain****Water Monitoring Report during Ganesha IDOL Immersion****Pond water near Banjari sewavata by-pass road, Ratlam.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.34	7.21	7.69
2	Total Solids	222	248	234
7	Dissolved Solids	212	232	220
4	D.Oxygen	7	6.8	7.1
5	BOD	2.2	3	2.8
6	COD	10	16	12
7	Turbidity	9.2	17.4	12.3
8	Conductivity	302	329	313
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	0.002	0.001

Ganesh Idol Immersion**YEAR -2023****R. O. Ujjain****Water Monitoring Report during Ganesha IDOL Immersion****River Maleni at road bridge, Jaora.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.92	7.34	7.89
2	Total Solids	642	656	644
7	Dissolved Solids	628	636	630
4	D.Oxygen	7.4	7	7.2
5	BOD	2	1.8	2.2
6	COD	16	20	18
7	Turbidity	6.9	11.2	8.3
8	Conductivity	896	912	899
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	0.002	0.004	0.002

Water Monitoring Report during Ganesha IDOL Immersion**Hira mill pond, Ujjain.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.21	7.29	7.91
2	Total Solids	670	718	682
7	Dissolved Solids	656	694	666
4	D.Oxygen	7.1	6.5	7
5	BOD	5	4	6
6	COD	18	26	22
7	Turbidity	6.9	11.2	8.4
8	Conductivity	956	995	949
9	Chromium	ND	0.001	0.002
10	Lead	ND	ND	ND
11	Zinc	ND	0.004	0.005
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Pond Water at Kalukhedi Talab, Dewas.****R. O. Ujjain**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.3	7.4	7.5
2	Total Solids	280	286	290
3	Dissolved Solids	260	262	270
4	D.Oxygen	7	7.2	6.9
5	BOD	2.2	2	2
6	COD	14	10	12
7	Turbidity	12	12.5	13.2
8	Conductivity	358	362	370
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	0.002	0.002
12	Copper	ND	0.003	0.003

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****R. O. Ujjain****River Lakhundar at Shajapur.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.3	7.3	7.5
2	Total Solids	306	310	320
7	Dissolved Solids	284	290	300
4	D.Oxygen	7.2	7.1	7.2
5	BOD	2.4	2.2	2.3
6	COD	16	12	16
7	Turbidity	13.4	14	14.6
8	Conductivity	450	458	462
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	0.002	0.003	0.002
12	Copper	0.004	0.004	0.004

Water Monitoring Report during Ganesha IDOL Immersion**River Narmada at Gwarighat, Jabalpur****R.O.Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.12	7.16	7.19
2	Total Solids	303	340	321
3	Dissolved Solids	269	304	286
4	D.Oxygen	7.5	6.3	7.4
5	BOD	1.8	1.6	1.3
6	COD	13	12	16
7	Turbidity	2.3	2.1	2.2
8	Conductivity	297.3	343.3	316
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Narmada at Tilwaraghat, Jabalpur.****R.O.Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.11	7.14	7.18
2	Total Solids	299	351	327
3	Dissolved Solids	268	311	289
4	D.Oxygen	7	6.9	7
5	BOD	1.8	1.7	1.8
6	COD	14	14	13
7	Turbidity	2.1	1.9	2
8	Conductivity	297	349.6	311
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion****River Narmada at near R/B Mandla**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.4	7.4	7.38
2	Total Solids	230	250	322
3	Dissolved Solids	140	170	270
4	D.Oxygen	7.6	7.4	7.6
5	BOD	1.8	1.6	1.8
6	COD	32	24	10
7	Turbidity	3	3	2
8	Conductivity	240	310	288
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Narmada at Barmanghat, Narsinghpur,near mainghat.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.78	8.11	7.4
2	Total Solids	293	495	298
3	Dissolved Solids	251	439	262
4	D.Oxygen	7.7	7.2	7.4
5	BOD	1.3	1.8	1.3
6	COD	10	8	12
7	Turbidity	4	3	0.9
8	Conductivity	296	611	290
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Narmada at Chinkighat, Narsinghpur****R.O.Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.11	7.67	7.74
2	Total Solids	681	336	488
3	Dissolved Solids	593	262	411
4	D.Oxygen	7	7.4	7.1
5	BOD	24	1.8	1.8
6	COD	24	12	12
7	Turbidity	8	5	3
8	Conductivity	819	282	623
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion****Visarjan kund at Chinkighat, Narsinghpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	6.89	—
2	Total Solids	—	710	—
3	Dissolved Solids	—	576	—
4	D.Oxygen	—	—	—
5	BOD	—	3.2	—
6	COD	—	48	—
7	Turbidity	—	12	—
8	Conductivity	—	981	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Ganesha IDOL Immersion**Hanumantal, Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.07	7.12	6.66
2	Total Solids	428	461	438
3	Dissolved Solids	380	373	375
4	D.Oxygen	5.8	5	4.8
5	BOD	2.8	3	3.1
6	COD	34	12	14
7	Turbidity	14	10.8	8.3
8	Conductivity	439.5	920.9	956
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	1.996	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	1.72	BDL

Water Monitoring Report during Ganesha IDOL Immersion**Adhartal, Jabalpur****R.O.Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.03	7.72	6.64
2	Total Solids	430	466	438
3	Dissolved Solids	383	377	368
4	D.Oxygen	5.2	4.2	5.7
5	BOD	3	3.3	3.3
6	COD	35	15	0.08
7	Turbidity	13.9	14.1	10.4
8	Conductivity	427.4	483.2	984.4
9	Chromium	BDL	0.022	BDL
10	Lead	BDL	1.058	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	0.701	BDL

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion
Gokalpurtal, Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.98	7.84	6.68
2	Total Solids	420	477	411
3	Dissolved Solids	366	389	343
4	D.Oxygen	5	4.4	4.6
5	BOD	2.8	3.8	3.1
6	COD	36	30	25
7	Turbidity	14.3	16	11
8	Conductivity	422.6	600.6	933.8
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	1.985	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	1.326	BDL

Water Monitoring Report during Ganesha IDOL Immersion**Temporary Visarjan kund at bhatauli at Gwarighat, Jabalpur**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	—	7.02	—
2	Total Solids	—	479	—
3	Dissolved Solids	—	313	—
4	D.Oxygen	—	3.5	—
5	BOD	—	4.3	—
6	COD	—	25	—
7	Turbidity	—	8.2	—
8	Conductivity	—	481.9	—
7	Chromium	—	BDL	—
8	Lead	—	BDL	—
9	Zinc	—	BDL	—
10	Copper	—	BDL	—

Water Monitoring Report during Ganesha IDOL Immersion**Temporary Visarjan kund at Tilwaraghat, Jabalpur.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	6.82	—
2	Total Solids	—	445	—
3	Dissolved Solids	—	357	—
4	BOD	—	5	—
5	COD	—	31	—
6	Turbidity	—	11.2	—
7	Chromium	—	BDL	—
8	Lead	—	BDL	—
9	Zinc	—	BDL	—
10	Copper	—	BDL	—

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion****Visarjan kund Barmanghat,Narsinghpur.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	6.94	—
2	Total Solids	—	766	—
3	Dissolved Solids	—	577	—
4	D. Oxygen	—	6.8	—
5	BOD	—	2.8	—
6	COD	—	24	—
7	Turbidity	—	16	—
8	Chromium	—	BDL	—
9	Lead	—	BDL	—
10	Zinc	—	BDL	—
11	Copper	—	BDL	—

Water Monitoring Report during Ganesha IDOL Immersion**visarjan kund Navghat,mandla.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.4	—
2	Total Solids	—	320	—
3	Dissolved Solids	—	230	—
4	D. Oxygen	—	7.5	—
5	BOD	—	1.9	—
6	COD	—	32	—
7	Conductivity	—	390	—
8	Turbidity	—	4	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion****Katni River Water at Mohanghat****Katni**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.3	7.43	7.4
2	Total Solids	280	334	268
3	Dissolved Solids	200	296	180
4	COD	32	10	24
5	Turbidity	3	4	2
6	Conductivity	310	392	300

Ganesh Idol Immersion**YEAR -2023****R.O.Jabalpur****Water Monitoring Report during Ganesha IDOL Immersion****Baba Ghat At Simrar River Katni.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.4	7.31	7.4
2	Total Solids	—	308	250
3	Dissolved Solids	210	262	160
4	COD	32	10	32
5	Turbidity	—	4	2
6	Conductivity	290	345	320
7	Chromium	—	—	—
8	Lead	BDL	—	—
9	Zinc	BDL	—	—
10	Copper	BDL	—	—

Water Monitoring Report during Ganesha IDOL Immersion**Gatar Ghat, Katni River**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.4	7.3	7.4
2	Total Solids	310	328	444
3	Dissolved Solids	220	288	392
4	BOD	1.9	1.8	2.8
5	COD	32	10	12
6	Turbidity	3	4	5
7	Conductivity	—	352	378
8	Chromium	NA	NA	BDL
9	Lead	NA	NA	BDL
10	Zinc	NA	NA	BDL
11	Copper	NA	NA	NA

Water Monitoring Report during Ganesha IDOL Immersion**River Amanvi, at Lahedara naka, Sagar.****R. O. Sagar**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.52	7.82	7.57
2	Total Solids	756	820	788
3	Dissolved Solids	698	668	690
4	D.Oxygen	8.48	4.7	6.36
5	BOD	3.8	6.5	5.8
6	COD	11.8	20	16
7	Turbidity	48	138	72
8	Conductivity	788.6	853.2	842.6
9	Chromium	0.031	BDL	0.007
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Ganesh Idol Immersion **YEAR -2023**
Water Monitoring Report during Ganesha IDOL Immersion
Futera Lake, Damoh.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.82	7.96	7.76
2	Total Solids	596	698	618
3	Dissolved Solids	498	566	578
4	D.Oxygen	6.27	5.4	6.32
5	BOD	2.4	5.28	4.78
6	COD	11.8	20	16
7	Turbidity	68	84	58.6
8	Conductivity	528.6	842.6	792.1
9	Chromium	0.03	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion
Budha Bandh, Chhatarpur.

R. O. Sagar

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.83	7.08	7.65
2	Total Solids	280	542	412
3	Dissolved Solids	248	406	366
4	D.Oxygen	6.28	5.14	6.38
5	BOD	2.6	4.8	3.76
6	COD	11.8	28	16
7	Turbidity	6.3	78	36
8	Conductivity	328.1	608.6	548.6
9	Chromium	0.029	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion

Dharam Sagar Lake, Panna , near chhatrasal collage,Benisagar mohalla.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.62	7.87	7.36
2	Total Solids	176	272	212
3	Dissolved Solids	144	184	162
4	D.Oxygen	6.9	5.2	6.4
5	BOD	2.1	4.9	3.6
6	COD	8	24	12
7	Turbidity	81	98	76
8	Conductivity	189.7	275.4	242.4
9	Chromium	0.021	0.023	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Ganesh Idol Immersion**YEAR -2023****R. O. Sagar****Water Monitoring Report during Ganesha IDOL Immersion****Immersion pond near Mahendra sagar lake,Tikamgarh.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.72	6.69	7.67
2	Total Solids	228	272	246
3	Dissolved Solids	186	194	188
4	D.Oxygen	6.32	4.8	6.22
5	BOD	2.8	7.76	3042
6	COD	8	24	16
7	Turbidity	12	26	18
8	Conductivity	278.4	291.6	288.4
9	Chromium	0.058	0.08	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**Pench River at Chhindwara ,near singori road bridge****R.O.Chhindwada**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.78	7.44	7.78
2	Total Solids	611	519	811
3	Dissolved Solids	531	453	531
4	D.Oxygen	7	7.3	3
5	BOD	2	1.6	2
6	COD	24	12	24
7	Turbidity	6	4	6
8	Conductivity	816	893	816
9	Chromium	—	BDL	—
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report**River Kulbehra Chhindwara ,near nagpur road bridge**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.52	7.43	8.1
2	Total Solids	619	493	566
3	Dissolved Solids	531	428	468
4	D.Oxygen	7.2	7.2	6.8
5	BOD	2	2	2.2
6	COD	16	12	24
7	Turbidity	3	2	8
8	Conductivity	744	611	716
9	Chromium	BDL	BDL	BDL
10	Lead	NA	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	NA	BDL	BDL

Ganesh Idol Immersion**YEAR -2023****R. O. Sagar****Water Monitoring Report during Ganesh anesh idol immersion****Chhota Talab at Chhindwara, main road Chhindwara**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.14	7.1	7.74
2	Total Solids	617	591	944
3	Dissolved Solids	529	475	780
4	D.Oxygen	7	7.5	6.8
5	BOD	2.8	2.8	2.8
6	COD	24	18	96
7	Turbidity	6	12	12
8	Conductivity	772	817	1244
9	Chromium	BDL	BDL	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	NA	BDL	BDL
12	Lead	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**Satna river,Satna.****R.O. Satna**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.5	7.6	7.3
2	Total Solids	534	729	728
3	Dissolved Solids	490	667	690
4	D.Oxygen	6.4	4.7	6.4
5	BOD	1.9	2.8	2
6	Turbidity	1	2	2
7	Conductivity	424	492	421
8	Chromium	1.783	1.778	2.083
9	Lead	BDL	BDL	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	4.15	3.72	5.16

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****River Tomus at Madhavagardh.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.4	7.8	7.5
2	Total Solids	348	388	375
3	Dissolved Solids	314	340	344
4	D.Oxygen	6.1	4.4	6.4
5	BOD	2	2.5	2.1
6	COD	16.4	28.8	18.4
7	Turbidity	1	3	2
8	Conductivity	506	459	536
9	Chromium	1.726	1.848	1.924
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	3.87	4.05	4.93

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****River Bicchiya, near road bridge , Rewa****R.O.Rewa**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.05	8.19	8.09
2	Total Solids	314	514	329
3	Dissolved Solids	285	372	296
4	Suspended solids	29	142	33
5	D.Oxygen	7.2	6.3	6.9
6	BOD	1.7	4.4	1.8
7	COD	14.7	38.22	17.64
8	Turbidity	9	58	11
9	Conductivity	356	455	368
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	BDL	BDL	BDL
13	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Bihar at karahaiya ghat, Rewa.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.96	8.22	7.8
2	Total Solids	298	567	305
3	Dissolved Solids	272	412	275
4	Suspended solids	26	155	30
5	D.Oxygen	7.6	6.8	7.2
6	BOD	1.3	4.6	1.5
7	COD	16.66	47.04	18.62
8	Turbidity	6	62	7
9	Conductivity	303	573	324
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	BDL	BDL	BDL
13	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Bicchiya temporary kund at chaturiya ghat, Rewa.**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	8.19	7.8	8.09
2	Total Solids	514	339	329
3	Dissolved Solids	372	215	296
4	Suspended solids	142	24	33
5	D.Oxygen	6.3	6.8	6.9
6	BOD	4.4	2	1.8
7	COD	38.22	16.66	17.64
8	Turbidity	58	7	11
9	Conductivity	455	373	368
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	BDL	BDL	BDL
13	Copper	BDL	BDL	BDL

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****River Sone at Churhat, Distt. Sidhi.****R.O.Sidhi**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.82	8.35	7.69
2	Total Solids	231	456	263
3	Dissolved Solids	204	318	233
4	Suspended solids	27	138	30
5	D.Oxygen	7.3	6.2	6.9
6	BOD	1.3	3.4	1.5
7	COD	7.84	29.4	8.82
8	Turbidity	6	42	8
9	Conductivity	232	355	257
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	BDL	BDL	BDL
13	Copper	BDL	BDL	BDL

Water Monitoring Report during Ganesha IDOL Immersion**River Sone at Gaughat, Distt. Sidhi.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.73	7.39	7.8
2	Total Solids	271	493	280
3	Dissolved Solids	242	360	248
4	Suspended solids	29	133	32
5	D.Oxygen	7.2	6.5	7
6	BOD	1.2	3.3	1.4
7	COD	7.84	37.24	8.82
8	Turbidity	5	48	7
9	Conductivity	286	472	315
10	Chromium	BDL	BDL	BDL
11	Lead	BDL	BDL	BDL
12	Zinc	BDL	BDL	BDL
13	Copper	BDL	BDL	BDL

R.O. Shahdol**Water Monitoring Report during Ganesha IDOL Immersion****River Narmada at Puskar Dam Amarkantak , Dist.Dindori**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.75	7.59
2	Total Solids	204	215	207
3	Dissolved Solids	189	194	196
4	D.Oxygen	7.7	7.5	7.6
5	BOD	1.7	1.9	1.8
6	COD	19.2	28.8	19.2
7	Turbidity	13.9	18.2	15
8	Conductivity	211.3	231.6	218.2
9	Chromium	1.229	1.227	1.056
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	4.344	5.711	7.602

Ganesh Idol Immersion YEAR -2023**Water Monitoring Report during Ganesha IDOL Immersion****Idol Immersion Temporary Pond Umariya Dist. Umariya.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.69	—
2	Total Solids	—	686	—
3	Dissolved Solids	—	561	—
4	D.Oxygen	—	5.2	—
5	BOD	—	3.3	—
6	COD	—	48	—
7	Turbidity	—	48.2	—
8	Conductivity	—	712.3	—
9	Chromium	—	0.842	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	6.2	—

Water Monitoring Report during Ganesha IDOL Immersion**River umarar at Umariya Dist. Umariya.**

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.26	6.74	7.45
2	Total Solids	249	486	232
3	Dissolved Solids	232	447	209
4	D.Oxygen	6.7	6.3	6.6
5	BOD	2.2	3.2	2.4
6	COD	28.8	38.4	19.2
7	Turbidity	21.8	45.6	31.2
8	Conductivity	321.6	526.5	319.4
9	Chromium	1.322	0.987	1.194
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	3.918	6.539	8.776

Water Monitoring Report during Ganesha IDOL Immersion**Idol Immersion pond Amarkantak Distt.Anuppur**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.59	7.76	8.03
2	Total Solids	207	412	219
3	Dissolved Solids	194	292	201
4	D.Oxygen	6.6	5.3	6.5
5	BOD	1.6	2.2	2.8
6	COD	9.6	28.8	38.4
7	Turbidity	13.2	32.4	22.6
8	Conductivity	236.4	436.4	251.3
9	Chromium	BDL	1.21	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	4.422	BDL

Ganesh Idol Immersion YEAR -2023
Water Monitoring Report during Ganesha IDOL Immersion
River sone at Diyapiper Dist. Shahdol

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.64	7.86	7.75
2	Total Solids	198	376	206
3	Dissolved Solids	186	348	195
4	D.Oxygen	7.5	6.8	7.8
5	BOD	1.2	1.6	1.4
6	COD	9.6	28.8	19.2
7	Turbidity	12.8	31.2	13.25
8	Conductivity	216.2	389.5	234
9	Chromium	1.056	1.233	0.982
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	2.299	4.687	8.239

Water Monitoring Report during Ganesha IDOL Immersion
Idol immersion Temporary pond Dindori Dist. Dindori

S. No.		Pre Immersion	During Immersion	After one week
1	pH	—	7.88	—
2	Total Solids	—	563	—
3	Dissolved Solids	—	475	—
4	D.Oxygen	—	5	—
5	BOD	—	2.8	—
6	COD	—	38.4	—
7	Turbidity	—	55.2	—
8	Conductivity	—	606.2	—
9	Chromium	—	1.138	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	7.159	—

Water Monitoring Report during Ganesha IDOL Immersion
River narmada at Dindori Dist. Dindori

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.64	7.7	7.94
2	Total Solids	197	285	209
3	Dissolved Solids	184	264	194
4	D.Oxygen	8.1	7.7	7.8
5	BOD	1.2	1.8	1.3
6	COD	9.6	19.2	9.6
7	Turbidity	11.2	16.5	10.4
8	Conductivity	216.5	360	231
9	Chromium	1.382	0.974	1.202
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	4.08	6.316	7.835

Ganesh Idol Immersion**YEAR -2023****R. O. Singrouli****Water Monitoring Report during Ganesha IDOL Immersion****Morwa stop dam near railway station,Singrauli.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.75	7.73	7.24
2	Total Solids	493	537	499
3	Dissolved Solids	425	468	441
4	D.Oxygen	7	5.8	6
5	BOD	1.8	2.3	2
6	COD	20	50	14
7	Turbidity	2.5	2.8	2.6
8	Conductivity	679	713	685
9	Chromium	2.134	2.198	2.031
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	7.54	5.53	7.23

Water Monitoring Report during Ganesha IDOL Immersion**Kachan river near Hirwah ganiyari ,singroli.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.72	7.81	7.77
2	Total Solids	419	463	548
3	Dissolved Solids	385	429	505
4	D.Oxygen	6.7	6	5.8
5	BOD	1.7	2.5	1.9
6	COD	22	45	19
7	Turbidity	2	2.9	2.1
8	Conductivity	608	697	720
9	Chromium	2.316	1.971	1.802
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	5.05	6.32	7.62

Water Monitoring Report during Ganesha IDOL Immersion**canal water near semra baba temple telgana,singroli.**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.14	7.2	7.13
2	Total Solids	366	418	384
3	Dissolved Solids	328	391	359
4	D.Oxygen	5.7	5	5.6
5	BOD	2	2.1	2
6	COD	13	20	10
7	Turbidity	2.8	3.7	2.3
8	Conductivity	568	615	585
9	Chromium	2.14	1.995	1.768
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	5.42	6.46	7.85

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Singwasa Pond at Guna****R.O. Guna**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.42	7.63	7.92
2	Total Solids	462	472	512
3	Dissolved Solids	397	404	436
4	D.Oxygen	7.2	6.9	6.6
5	BOD	2.4	2	2.6
6	COD	38	40	70
7	Turbidity	2	2	5
8	Conductivity	260	636	690
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**Tulsi Pond at Ashoknagar**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.42	7.62	7.7
2	Total Solids	742	460	410
3	Dissolved Solids	648	498	354
4	D.Oxygen	0	7	7.2
5	BOD	24	2.2	2.1
6	COD	118	38	34.4
7	Turbidity	0	2	3
8	Conductivity	0	780	560
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Ganesha IDOL Immersion**water sample from gauri ganesh kund near Jadhav sagar at shivpuri**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.2	7.29	7.7
2	Total Solids	985	475	290
3	Dissolved Solids	889	407	254
4	D.Oxygen	0	7.2	7.4
5	BOD	0	2.2	2.2
6	COD	na	46	31
7	Turbidity	5.4	2.2	3
8	Conductivity	746	630	380
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Ganesh Idol Immersion**YEAR -2023****Water Monitoring Report during Ganesha IDOL Immersion****Sankhya sagar ,Shivpuri**

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.88	7.34	7.7
2	Total Solids	398	580	480
3	Dissolved Solids	345	520	404
4	D.Oxygen	0	7.4	7
5	BOD	0	1.4	1.6
6	COD	0	44	54
7	Turbidity	2.4	3	2.6
8	Conductivity	652	820	630

Madhav lake shivpuri 3 km from bhadaiya kund.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.55	7.62	7.56
2	Total Solids	298	560	375
3	Dissolved Solids	256	450	318
4	D.Oxygen	0	7.6	7.2
5	BOD	0	1.7	1.4
6	COD	32	52	85
7	Turbidity	2.6	2	2.4
8	Conductivity	560	760	490

Amahi lake at Ashoknagar,guna

S.No.		Pre Immersion	During Immersion	After one week
1	pH	7.8	7.38	7.64
2	Total Solids	325	346	275
3	Dissolved Solids	276	298	250
4	D.Oxygen	7.8	7	7.7
5	BOD	1.8	1.6	1.5
6	COD	32	38	11
7	Turbidity	4	2.2	4
8	Conductivity	442	460	417

Gopi kishan sagar ,Guna.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.8	7.57	-
2	Total Solids	650	155	-
3	Dissolved Solids	529	130	-
4	D.Oxygen	7.2	7.8	-
5	BOD	2.2	1.5	-
6	COD	25.14	16	-
7	Turbidity	1.9	2	-
8	Conductivity	520	208	-

Madhikheda dam at shivpuri,guna.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.5	7.6	7.22
2	Total Solids	298	290	456
3	Dissolved Solids	260	254	400
4	D.Oxygen	7.23	7.4	7
5	BOD	1.5	1.6	1.6
6	COD	14	18	115.25
7	Turbidity	1.4	2	2
8	Conductivity	550	400	615

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Janki kund near Charantirth ghat, Vidisha,Bhopal.

R.O. Bhopal

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.03	7.64	7.64
2	Total Solids	476	312	756
3	Dissolved Solids	448	256	668
4	D.Oxygen	6.6	4.6	14.8
5	BOD	0.5	1.8	1.4
6	COD	10	10	10
7	Turbidity	3.2	3.6	2
8	Conductivity	665.5	438.2	903.3
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	0.12	BDL
11	Zinc	0.028	0.133	0.104
12	Copper	0.008	0.048	0.115

Water Monitoring Report during Durga IDOL Immersion

Murti visarjan kund,Rajgarh,Bhopal.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.03	7.02	7.55
2	Total Solids	342	308	274
3	Dissolved Solids	266	273	242
4	D.Oxygen	5.9	4.7	4.6
5	BOD	6	3	4.4
6	COD	38.4	20	19.76
7	Turbidity	27.4	6.5	2.8
8	Conductivity	377	449	371.4
9	Chromium	NA	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	0.023	0.074	0.08
12	Copper	0.023	0.062	BDL

Water Monitoring Report during Durga IDOL Immersion

Murti visarjan kund near Town-Hall ,Sehore.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.07	7.19	7.59
2	Total Solids	294	315	422
3	Dissolved Solids	266	276	386
4	D.Oxygen	7.2	6.5	4.9
5	BOD	1.2	2.4	—
6	COD	10	20	19.76
7	Turbidity	1.1	6.5	3.9
8	Conductivity	439.2	460	590.1
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	0.01	0.07	0.016
12	Copper	0.018	0.045	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Hathaikheda dam (ghat),bhopal.

R.O. Bhopal

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.02	8.02	8.15
2	Total Solids	408	554	524
3	Dissolved Solids	342	398	428
4	D.Oxygen	6.5	10.2	8.6
5	BOD	4	8.8	2.4
6	COD	30	50	39.2
7	Turbidity	29.6	7.02	42.4
8	Conductivity	549	583.4	578.2
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	0.11	0.1
11	Zinc	0.025	0.286	0.135
12	Copper	BDL	0.052	0.16

Water Monitoring Report during Durga IDOL Immersion

Rani kamlapati visarjan ghat (lower lake)

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.07	7.63	7.54
2	Total Solids	386	394	420
3	Dissolved Solids	318	329	348
4	D.Oxygen	6.2	6	6.5
5	BOD	8.8	8.4	8.6
6	COD	90	90	98
7	Turbidity	12.1	14.2	15.4
8	Conductivity	465.2	473	601.8
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	0.068	0.063	0.013
12	Copper	0.048	0.038	0.008

Water Monitoring Report during Durga IDOL Immersion

Khatlapura visarjan ghat (Lower lake),Bhopal.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.87	8.2	7.46
2	Total Solids	396	402	470
3	Dissolved Solids	348	352	402
4	D.Oxygen	4.5	4.2	4.4
5	BOD	6.4	—	7.8
6	COD	40	40	58.8
7	Turbidity	6.21	6.7	26.7
8	Conductivity	528	533	543.2
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	0.027	0.068	0.015
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Sant Hirdaram visarjan kund,Bairagarh(upper lake),Bhopal.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.32	7.55	7.81
2	Total Solids	1364	1558	1574
3	Dissolved Solids	1150	1418	1422
4	D.Oxygen	0	0	4.2
5	BOD	9.2	9	9.4
6	COD	70	70	98
7	Turbidity	39.4	35.7	41.5
8	Conductivity	1686	1688	1882
9	Chromium	BDL	BDL	BDL
10	Lead	0.16	0.11	BDL
11	Zinc	0.03	0.103	0.063
12	Copper	BDL	0.053	0.074

Water Monitoring Report during Durga IDOL Immersion

Prempura ghat, Bhopal.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.66	—	7.39
2	Total Solids	244	298	304
3	Dissolved Solids	192	212	212
4	D.Oxygen	5.4	5	5.7
5	BOD	—	—	—
6	COD	40	40	58.8
7	Turbidity	9.3	9.9	13.9
8	Conductivity	323.1	345	356.1
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	0.06	BDL
11	Zinc	0.02	0.074	0.013
12	Copper	BDL	0.075	0.009

Water Monitoring Report during Durga IDOL Immersion

Murti-visarjan ghat at Shahpura lake,Bhopal.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.35	7.73	7.76
2	Total Solids	554	570	732
3	Dissolved Solids	478	498	648
4	D.Oxygen	4.5	4	5
5	BOD	6.4	6.8	7.8
6	COD	40	50	39.2
7	Turbidity	19.4	24	27.2
8	Conductivity	779.3	800	881.5
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	0.14	BDL
11	Zinc	0.056	0.363	0.068
12	Copper	0.047	0.121	0.081

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Maalikhedi visarjan kund,bhopal.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.57	7.37	7.81
2	Total Solids	702	740	992
3	Dissolved Solids	584	605	840
4	D.Oxygen	4.6	4.3	10.4
5	BOD	6.8	6.8	6.6
6	COD	40	50	49
7	Turbidity	24.6	25.3	34.3
8	Conductivity	1017	1089	1506
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	0.14	BDL
11	Zinc	0.024	0.064	0.063
12	Copper	BDL	0.058	0.059

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Gwarighat ,Jabalpur

R.O. Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.68	7.1	7.44
2	Total Solids	292	164	388
3	Dissolved Solids	253	146	322
4	D.Oxygen	7.8	7.8	7.5
5	BOD	1.6	1.2	1.9
6	COD	15	10	10
7	Turbidity	0.8	0	6
8	Conductivity	288	274	358
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Visarjan kund ,bhatauli at Gwarighat ,Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.08	—
2	Total Solids	—	287	—
3	Dissolved Solids	—	194	—
4	D.Oxygen	—	6.2	—
5	BOD	—	2.7	—
6	COD	—	30	—
7	Turbidity	—	10	—
8	Conductivity	—	370	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Tilwaraghat Jabalpur

R.O. Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.84	7.94	7.48
2	Total Solids	288	219	396
3	Dissolved Solids	250	191	322
4	D.Oxygen	7.6	7.4	7.3
5	BOD	1.8	1.3	—
6	COD	20	12	12
7	Turbidity	0.9	0	6
8	Conductivity	286	298	352
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Visarjan kund at Tilwaraghat Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
1	pH	—	6.91	—
2	Total Solids	—	258	—
3	Dissolved Solids	—	213	—
4	D.Oxygen	—	6.4	—
5	BOD	—	3.1	—
6	COD	—	16	—
7	Turbidity	—	10	—
8	Conductivity	—	448	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Durga IDOL Immersion

Adhartal, Jabalpur.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.29	6.68	6.86
2	Total Solids	371	423	382
3	Dissolved Solids	307	339	335
4	D.Oxygen	6	6.3	6.6
5	BOD	3.6	3.8	2.4
6	COD	30	36	30
7	Turbidity	5	34.2	16
8	Conductivity	368	502	488
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Visarjan kund at Adhartal,jabalpur.

R.O. Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	6.56	—
2	Total Solids	—	318	—
3	Dissolved Solids	—	220	—
4	D.Oxygen	—	5.3	—
5	BOD	—	3.6	—
6	COD	—	28	—
7	Turbidity	—	36	—
8	Conductivity	—	490	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Durga IDOL Immersion

Hanumantal, Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.26	6.76	6.85
2	Total Solids	394	428	329
3	Dissolved Solids	326	239	254
4	D.Oxygen	6	6.2	6.8
5	BOD	2.6	3.2	2.5
6	COD	26	30	30
7	Turbidity	4.6	19.8	11
8	Conductivity	382	966	788
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Gokalpurtal, Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.13	7.22	7.34
2	Total Solids	406	323	381
3	Dissolved Solids	334	259	321
4	D.Oxygen	5.5	6.7	6.8
5	BOD	3.3	3.8	2.4
6	COD	32	40	30
7	Turbidity	6.8	6.5	5.8
8	Conductivity	393	593	556
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Visarjan kund at Gokalpur.

R.O. Jabalpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.48	—
2	Total Solids	—	348	—
3	Dissolved Solids	—	258	—
4	D.Oxygen	—	5.4	—
5	BOD	—	2.8	—
6	COD	—	40	—
7	Turbidity	—	34	—
8	Conductivity	—	484	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Chinkighat, Narsinghpur

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.88	3.36	7.61
2	Total Solids	283	262	356
3	Dissolved Solids	246	74	284
4	D.Oxygen	7.4	7.4	7.4
5	BOD	1.5	1.8	1.9
6	COD	13	12	12
7	Turbidity	0.9	5	6
8	Conductivity	274	282	338
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Mandla, near road bridge.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.83	7.38	7.94
2	Total Solids	293	322	501
3	Dissolved Solids	260	270	435
4	D.Oxygen	7.2	7.6	7.1
5	BOD	1.8	1.8	2
6	COD	16	10	12
7	Turbidity	0.8	2	3
8	Conductivity	285	288	611
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Barmanghat,Narsinghpur.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.43	7.32	7.53
2	Total Solids	298	326	204
3	Dissolved Solids	262	254	172
4	D.Oxygen	7.4	7.5	7.6
5	BOD	1.3	1.8	1.3
6	COD	12	10	12
7	Turbidity	0.9	3	0.7
8	Conductivity	290	282	273
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Durga visarjan kund gatarghat,Katni.

R.O. Katni

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.66	—
2	Total Solids	—	414	—
3	Dissolved Solids	—	342	—
4	D.Oxygen	—	7.3	—
5	BOD	—	3.8	—
6	COD	—	12	—
7	Turbidity	—	7	—
8	Conductivity	—	382	—
9	Lead	—	—	—
10	Zinc	—	—	—
11	Copper	—	—	—
12	Chromium	—	—	—

Water Monitoring Report during Durga IDOL Immersion

Durga visarjan kund mohanghat,Katni.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.91	—
2	Total Solids	—	544	—
3	Dissolved Solids	—	456	—
4	D.Oxygen	—	6.9	—
5	BOD	—	—	—
6	COD	—	16	—
7	Turbidity	—	7	—
8	Conductivity	—	422	—
9	Lead	—	—	—
10	Zinc	—	—	—
11	Copper	—	—	—
12	Chromium	—	—	—

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Durga visarjan kund Baba Ghat ,Katni.

R.O. Katni

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	7.98	—
2	Total Solids	—	428	—
3	Dissolved Solids	—	342	—
4	D.Oxygen	—	7.2	—
5	BOD	—	3.8	—
6	COD	—	16	—
7	Turbidity	—	8	—
8	Conductivity	—	—	—
9	Lead	—	—	—
10	Zinc	—	—	—
11	Copper	—	—	—
12	Chromium	—	—	—

Water Monitoring Report during Durga IDOL Immersion

katni river near gatarghat.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.64	7.4	7.41
2	Total Solids	434	444	410
3	Dissolved Solids	382	392	332
4	D.Oxygen	7.4	7.4	7.6
5	BOD	2.6	2.8	1.8
6	COD	10	12	10
7	Turbidity	4	5	5
8	Conductivity	368	378	362
9	Lead	BDL	BDL	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	BDL	BDL	BDL
12	Chromium	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Katni river near mohanghat

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.51	7.21	7.51
2	Total Solids	496	470	404
3	Dissolved Solids	414	382	322
4	D.Oxygen	7.3	7.5	7.5
5	BOD	2.8	1.8	1.8
6	COD	12	12	12
7	Turbidity	5	6	5
8	Conductivity	374	356	NA
9	Lead	BDL	BDL	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	BDL	BDL	BDL
12	Chromium	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Simrar river near Babaghat, katni.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.31	7.57	7.48
2	Total Solids	382	386	462
3	Dissolved Solids	322	334	382
4	D.Oxygen	7.4	334	7.4
5	BOD	2.5	1.8	1.9
6	COD	12	12	12
7	Turbidity	4	6	5
8	Conductivity	368	368	362
9	Lead	BDL	—	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	BDL	BDL	BDL
12	Chromium	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Singwasa Pond at Guna

R.O. Guna

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.61	7.64
2	Total Solids	717	474	713
3	Dissolved Solids	650	412	656
4	D.Oxygen	7.2	7	7.3
5	BOD	2.2	2	2.1
6	COD	16	38	15
7	Turbidity	4	2	—
8	Conductivity	1040	640	1049
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Tulsi Pond at Ashoknagar

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.64	7.4	7.65
2	Total Solids	612	440	603
3	Dissolved Solids	570	382	565
4	D.Oxygen	7.4	7.8	7.5
5	BOD	1.8	2	1.7
6	COD	14	38.2	13
7	Turbidity	5	2	3
8	Conductivity	912	600	904
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Morwa stop dam near railway station, Singrauli.

R. O. Singrouli

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.42	7.8	7.24
2	Total Solids	407	664	621
3	Dissolved Solids	352	589	561
4	D.Oxygen	7.7	6.2	7.4
5	BOD	1.6	2.7	1.8
6	COD	23	62	25
7	Turbidity	3	7.2	4
8	Conductivity	617.8	810	628.4
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	0.272	1.654	1.622

Water Monitoring Report during Durga IDOL Immersion

kachan river near Hirwah ganiyari, singroli.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.82	7.9	7.5
2	Total Solids	459	483	555
3	Dissolved Solids	437	456	531
4	D.Oxygen	6.2	5.5	5.9
5	BOD	1.8	2.5	1.9
6	COD	19	40	22
7	Turbidity	4	6.4	5
8	Conductivity	618	772.88	599
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	2.4	3.734	2.388

Water Monitoring Report during Durga IDOL Immersion

Satna river, Distt Satna

R.O. Satna

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.12	8.71	7.4
2	Total Solids	341	442	390
3	Dissolved Solids	304	396	360
4	D.Oxygen	4.8	4	5.1
5	BOD	2.1	3	2.2
6	COD	22.2	24	26.4
7	Turbidity	—	3	2
8	Conductivity	514	695	606
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	0.981	1.718	1.365

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Tomus at Madhavgarh ,dist-satna

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8	8.13	7.8
2	Total Solids	383	415	323
3	Dissolved Solids	349	372	294
4	D.Oxygen	5.4	4.6	5.9
5	BOD	2.4	2.6	2
6	COD	18.4	20.1	20
7	Turbidity	2	4	1
8	Conductivity	587	644	526
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	2.323	0.954	1.189

Water Monitoring Report during Durga IDOL Immersion

River Bicchiya ne near chaturiya ghat, Rewa.

R.O. Rewa

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.76	7.96	7.8
2	Total Solids	329	511	339
3	Dissolved Solids	304	373	315
4	D.Oxygen	6.7	6.6	6.8
5	BOD	1.9	4.7	2
6	COD	15.36	43.2	16.66
7	Turbidity	6	47	7
8	Conductivity	369	553	373
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	4.005	2.268	5.637

Water Monitoring Report during Durga IDOL Immersion

River Beehar at Karahaiya ghat ,Rewa.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.86	8.27	8.1
2	Total Solids	270	498	283
3	Dissolved Solids	248	363	258
4	D.Oxygen	7.5	7	7.3
5	BOD	1.7	4.8	1.8
6	COD	9.6	46.08	9.8
7	Turbidity	4	69	6
8	Conductivity	291	516	296
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	3.956	1.848	4.56

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Sone near Rd, Bridge at Churhat distt. Sidhi

R.O.Sidhi

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.7	8.49	7.96
2	Total Solids	271	434	276
3	Dissolved Solids	249	313	256
4	D.Oxygen	7.2	6.7	7.1
5	BOD	1.2	3.6	1.4
6	COD	7.68	30.72	9.8
7	Turbidity	2	22	4
8	Conductivity	270	458	293
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	0.51	2.025	2.32

Water Monitoring Report during Durga IDOL Immersion

River Sone at Gaughat vill. Patpara. Distt. Sidhi

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.69	8.44	7.8
2	Total Solids	265	525	303
3	Dissolved Solids	242	415	277
4	D.Oxygen	7	6.8	7.1
5	BOD	1.3	3.6	1.5
6	COD	8.64	39.36	9.8
7	Turbidity	2	19	4
8	Conductivity	295	496	303
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	0.846	1.775	2.386

Water Monitoring Report during Durga IDOL Immersion

River Kshipra at Kaliyadeh Palace, Ujjain.

R. O. Ujjain

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.72	7.97	7.99
2	Total Solids	710	724	730
3	Dissolved Solids	696	708	716
4	D.Oxygen	6.8	6.7	7
5	BOD	10	8	11
6	COD	28	30	32
7	Turbidity	4.7	11.8	9.2
8	Conductivity	993	1012	1026
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Pond water near sanjeevani nallah,Neemuch.

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.83	7.61	DRY
2	Total Solids	792	816	—
3	Dissolved Solids	778	796	—
4	D.Oxygen	6.7	6.5	—
5	BOD	2.6	2.4	—
6	COD	16	20	—
7	Turbidity	9.7	13.2	—
8	Conductivity	1112	1189	—
9	Chromium	ND	ND	—
10	Lead	ND	ND	—
11	Zinc	ND	ND	—
12	Copper	ND	ND	—

Water Monitoring Report during Durga IDOL Immersion

Pond water near Banjari,sejawata by pass road,Ratlam

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.89	7.24	7.61
2	Total Solids	224	262	286
3	Dissolved Solids	212	248	272
4	D.Oxygen	7.4	7.3	7.2
5	BOD	2	2.8	2.6
6	COD	12	14	10
7	Turbidity	8.3	11.2	7.3
8	Conductivity	305	352	390
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Parshukhedi talab at Agar-Malwa.

S. No.	Parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.92	7.57	7.87
2	Total Solids	372	390	394
3	Dissolved Solids	358	372	378
4	D.Oxygen	7.1	6.8	7.1
5	BOD	2.6	2.2	2.4
6	COD	14	18	16
7	Turbidity	9.3	10.9	11.1
8	Conductivity	512	526	541
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Shail Mining Multanpura,Mandsaur

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.93	7.15	7.92
2	Total Solids	678	688	706
3	Dissolved Solids	668	674	690
4	D.Oxygen	6.2	6	6.1
5	BOD	1.8	2.4	2
6	COD	10	14	12
7	Turbidity	1.4	1.9	2.2
8	Conductivity	651	963	987
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Hira Mill Pond,Ujjain.

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.96	7.94	7.44
2	Total Solids	758	776	764
3	Dissolved Solids	742	754	744
4	D.Oxygen	6.9	6.4	6.9
5	BOD	8	6	7
6	COD	20	26	28
7	Turbidity	11.4	13.9	12.5
8	Conductivity	1058	1075	1064
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

River Chambal near Khachrod road Chamundamata Mandir, Nagda.

S. No.	Parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.15	8.38	7.34
2	Total Solids	506	522	514
3	Dissolved Solids	496	508	498
4	D.Oxygen	7.6	7.6	7.5
5	BOD	2.6	2.8	2.4
6	COD	16	20	14
7	Turbidity	5.7	6.1	7.4
8	Conductivity	706	728	704
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Maleni at road bridge, jaora

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.74	7.29	7.65
2	Total Solids	678	702	670
3	Dissolved Solids	666	684	658
4	D.Oxygen	7.4	7.3	7.2
5	BOD	2.2	2	2
6	COD	14	18	16
7	Turbidity	8.6	10.8	10.6
8	Conductivity	952	973	938
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Lakhundar river at Shajapur

R.O.Dewas

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.07	8.06	7.29
2	Total Solids	768	380	362
3	Dissolved Solids	356	364	358
4	D.Oxygen	7	6.9	6.7
5	BOD	2	2.4	2.2
6	COD	12	16	14
7	Turbidity	6.3	11.7	9.2
8	Conductivity	508	520	513
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Pond Water at Kalukhedi talab,Dewas

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	8.09	7.14	7.16
2	Total Solids	390	398	398
3	Dissolved Solids	374	378	384
4	D.Oxygen	6.9	6.8	6.8
5	BOD	2.2	2	2
6	COD	12	18	15
7	Turbidity	11.2	14.6	10.4
8	Conductivity	533	541	547
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Idol immersion temporary pond Umariya,disst.Umariya.

R.O. Shahdol

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	8.2	—
2	Total Solids	—	579	—
3	Dissolved Solids	—	387	—
4	D.Oxygen	—	5.3	—
5	BOD	—	2.9	—
6	COD	—	50	—
7	Turbidity	—	115.4	—
8	Conductivity	—	985.2	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Durga IDOL Immersion

Idol immersion pond Dindori disst.Dindori.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	—	8.07	—
2	Total Solids	—	615	—
3	Dissolved Solids	—	444	—
4	D.Oxygen	—	5.5	—
5	BOD	—	2.6	—
6	COD	—	60	—
7	Turbidity	—	102	—
8	Conductivity	—	825.4	—
9	Chromium	—	BDL	—
10	Lead	—	BDL	—
11	Zinc	—	BDL	—
12	Copper	—	BDL	—

Water Monitoring Report during Durga IDOL Immersion

Idol immersion pond Amarkantak disst.Auppur.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.69	8.07	8.28
2	Total Solids	226	618	245
3	Dissolved Solids	203	431	226
4	D.Oxygen	6.7	5.4	6.5
5	BOD	1.8	3	2.8
6	COD	20	50	40
7	Turbidity	25.4	112.4	35.7
8	Conductivity	287.4	731	370.2
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Umrar at unUmariya near khalesar ghat Distt. Umaria.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.69	8.02	7.84
2	Total Solids	277	319	245
3	Dissolved Solids	258	278	218
4	D.Oxygen	6.6	6.3	6.4
5	BOD	2.3	3.2	2.4
6	COD	20	40	20
7	Turbidity	18.5	37.2	21.4
8	Conductivity	346.2	487.5	416
9	Chromium	BDL	0.024	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

River Narmada at at Dindori near road bridge,Distt.Dindori.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.79	7.92	7.87
2	Total Solids	198	225	203
3	Dissolved Solids	188	209	190
4	D.Oxygen	8	7.8	8.2
5	BOD	1.4	1.6	1.2
6	COD	10	20	10
7	Turbidity	7.8	11.4	8.4
8	Conductivity	217.2	298	232.4
9	Chromium	BDL	BDL	0.013
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

River sone at Diyapeper near road bridge,dist.Shahdol.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.54	8.01	7.62
2	Total Solids	189	361	214
3	Dissolved Solids	179	274	202
4	D.Oxygen	7.7	6.7	7.6
5	BOD	1.3	2	1.4
6	COD	10	30	10
7	Turbidity	7.2	41.5	—
8	Conductivity	216	425.6	218
9	Chromium	0.094	BDL	0.069
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Narmada at Amarkantak from Pushkar dam ,Distt. Shahdol.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.58	7.85	7.69
2	Total Solids	198	221	201
3	Dissolved Solids	187	205	188
4	D.Oxygen	7.8	7.6	7.5
5	BOD	1.8	2	1.7
6	COD	20	30	20
7	Turbidity	12.4	16.2	9.6
8	Conductivity	221.4	236.4	227.2
9	Chromium	0.049	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Sagar Tal.

R.O. Gwalior

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.75	7.77	7.82
2	Total Solids	718	755	742
3	Dissolved Solids	670	690	694
4	D.Oxygen	7.2	7.1	7.2
5	BOD	2.1	2.2	2.2
6	COD	25	26	28
7	Turbidity	6	8	7
8	Conductivity	1072	1118	1072
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Badokher talab,morena

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.65	7.62	7.64
2	Total Solids	630	748	732
3	Dissolved Solids	570	675	668
4	D.Oxygen	7.1	7.1	7.2
5	BOD	2.1	2.3	2.2
6	COD	24	25	24
7	Turbidity	3	6	5
8	Conductivity	900	1080	1068
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Karan Sagar, Datia.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.25	7.2	7
2	Total Solids	556	460	480
3	Dissolved Solids	476	420	400
4	D.Oxygen	7.2	7.2	—
5	BOD	2.4	2.4	2.4
6	COD	38	38	115
7	Turbidity	2.4	2	2.2
8	Conductivity	735	660	615
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Sita Sagar, Datia.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.48	7.7	7.39
2	Total Solids	625	719	476
3	Dissolved Solids	536	680	400
4	D.Oxygen	7.4	7.3	—
5	BOD	2.6	2	2.4
6	COD	54	24	116
7	Turbidity	2.4	5	2.4
8	Conductivity	825	1083	615
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Lala Ka Tal, Datia.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.45	7.42	7.46
2	Total Solids	466	565	396
3	Dissolved Solids	394	478	326
4	D.Oxygen	72	7.2	70
5	BOD	2.4	2.5	2.4
6	COD	38.4	42	78
7	Turbidity	2.4	6	2.4
8	Conductivity	610	2.5	510
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Jaderua dam,Gwalior

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.69	7.7	7.74
2	Total Solids	787	813	746
3	Dissolved Solids	730	740	692
4	D.Oxygen	7.1	7	7.2
5	BOD	2.2	2.3	2.2
6	COD	26	27	28
7	Turbidity	6	8	7
8	Conductivity	1219	1184	1068
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Pandit ghat ,Sheopur.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.25	7.3	7.46
2	Total Solids	462	360	460
3	Dissolved Solids	400	300	400
4	D.Oxygen	7	7	7
5	BOD	2.4	2	1.8
6	COD	114	44	56
7	Turbidity	2.2	2	2
8	Conductivity	615	465	615
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Chonda pool .

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.62	7.46	7.32
2	Total Solids	420	440	430
3	Dissolved Solids	390	410	398
4	D.Oxygen	7.6	7.3	7.5
5	BOD	2.1	2.2	2.1
6	COD	32	28.6	35
7	Turbidity	2	2	2
8	Conductivity	610	640	620
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Kwari river ,phoof ,Bhind.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.6	7.6	7.7
2	Total Solids	340	290	330
3	Dissolved Solids	304	240	300
4	D.Oxygen	7.2	7.4	7.4
5	BOD	2	2.1	2
6	COD	31	27	35
7	Turbidity	2	2	2
8	Conductivity	480	380	770
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Gauri sarover ,bhind

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.68	7.1	7.2
2	Total Solids	330	360	340
3	Dissolved Solids	292	322	304
4	D.Oxygen	7.4	7	7.4
5	BOD	2.2	2.1	2
6	COD	24	28.6	25.4
7	Turbidity	3	2	2
8	Conductivity	450	500	476
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Water Monitoring Report during Durga IDOL Immersion

Katora taal near G.R. Medical collage,gwalior.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.67	7.68	7.8
2	Total Solids	687	733	864
3	Dissolved Solids	650	670	760
4	D.Oxygen	7.1	7	7.1
5	BOD	2.2	2.3	2.2
6	COD	27	28	28
7	Turbidity	6	8	8.2
8	Conductivity	1040	1072	1182
9	Chromium	ND	—	ND
10	Lead	ND	—	ND
11	Zinc	ND	—	ND
12	Copper	ND	—	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Kund near renuka jhil at Burhanpur.

R.O. Indore

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.83	7.77	7.4
2	Total Solids	898	1050	1113
3	Dissolved Solids	882	1022	1072
4	D.Oxygen	6.6	5.8	5.2
5	BOD	1.6	2.2	2.6
6	COD	22	30	38
7	Turbidity	13.2	22	23.7
8	Conductivity	1342.9	1600	1548
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Kund near Narmada at Mortakka bridge,Barwah.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.6	7.72	–
2	Total Solids	356	697	–
3	Dissolved Solids	344	660	–
4	D.Oxygen	6.8	7.2	–
5	BOD	1.4	2.6	–
6	COD	12	28	–
7	Turbidity	22.4	34.4	–
8	Conductivity	641	1003	–
9	Chromium	ND	ND	–
10	Lead	ND	ND	–
11	Zinc	ND	ND	–
12	Copper	ND	ND	–

Water Monitoring Report during Durga IDOL Immersion

Kund water of idol immersion Maheshwar,khargone.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.84	7.64	7.46
2	Total Solids	363	234	561
3	Dissolved Solids	330	222	532
4	D.Oxygen	6	6.8	3.9
5	BOD	1.4	1.8	2.6
6	COD	37.75	18	32
7	Turbidity	13.7	8.2	17.2
8	Conductivity	500	337	806
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	0.15	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Kund water of idol immersion near River Kunda at Khargone

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.81	7.84	7.61
2	Total Solids	474	639	339
3	Dissolved Solids	433	612	324
4	D.Oxygen	2.5	3.9	6.2
5	BOD	3.2	3.2	1.6
6	COD	64.85	36	16
7	Turbidity	23	16.8	8.9
8	Conductivity	658	880.4	492.22
9	Chromium	0.1	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	0.02	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Kund water sample of idol immersion at Rajghat,Badwani.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.63	7.56	7.73
2	Total Solids	373	249	450
3	Dissolved Solids	325	238	432
4	D.Oxygen	7.5	7.2	5.9
5	BOD	1.2	1.4	2
6	COD	22.26	15	24
7	Turbidity	32.5	10.2	21.2
8	Conductivity	491	362	660.09
9	Chromium	0.11	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	0.01	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Padam kund of idol immersion at khandwa.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.57	7.51	7.04
2	Total Solids	712	1050	1260
3	Dissolved Solids	691	1017	1234
4	D.Oxygen	6.9	4	4
5	BOD	2.2	3.2	16
6	COD	26	34	44
7	Turbidity	22.2	36	22.6
8	Conductivity	1078	1470	1870
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Kund near Narmada at Brahmpuri ghat,omkareshwar.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.88	7.82	6.9
2	Total Solids	207	340	1339
3	Dissolved Solids	198	325	1310
4	D.Oxygen	7.3	6.8	3.1
5	BOD	1.2	1.8	18
6	COD	11	22	52
7	Turbidity	1.6	8	37
8	Conductivity	306	491	2079
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Jawahar tekrey ,indore.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.85	7.4	7.52
2	Total Solids	501	558	526
3	Dissolved Solids	493	538	510
4	D.Oxygen	6	6	6.4
5	BOD	1.4	2.2	2
6	COD	26	28	22
7	Turbidity	5.9	4.4	3.9
8	Conductivity	748	804	843
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	—	—	—
12	Copper	—	—	—

Water Monitoring Report during Durga IDOL Immersion

Idol immersion kund water at near Anas river ,Jhabua.

R.O. Dhar

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.76	7.67	7.69
2	Total Solids	427	290	611
3	Dissolved Solids	396	289	588
4	D.Oxygen	6.6	7.2	4.1
5	BOD	2	1.2	2.4
6	COD	21.29	16	24
7	Turbidity	15.5	2.4	4.7
8	Conductivity	525	439	840
9	Chromium	0.1	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Kund water of idol immersion near filtration plant,Dhar.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.72	7.63	—
2	Total Solids	301	410	—
3	Dissolved Solids	283	396	—
4	D.Oxygen	4.1	4.4	—
5	BOD	1.4	1.4	—
6	COD	26.13	18	—
7	Turbidity	10.3	10.4	—
8	Conductivity	329	568.78	—
9	Chromium	0.5	ND	—
10	Lead	ND	ND	—
11	Zinc	ND	ND	—
12	Copper	0.1	ND	—

Water Monitoring Report during Durga IDOL Immersion

Kund water of idol immersion near sanjay jalasay,pithampur.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.85	7.67	7.44
2	Total Solids	303	195	297
3	Dissolved Solids	289	187	285
4	D.Oxygen	6.7	7.3	6
5	BOD	1.4	1	1.8
6	COD	22.26	14	24
7	Turbidity	14.6	2.7	8
8	Conductivity	438	14	431.49
9	Chromium	0.2	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	0.14	ND	ND

Water Monitoring Report during Durga IDOL Immersion

Bavdi water sample of idol immersion at Dharampuri ,Dhar.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.59	7.86	7.89
2	Total Solids	328	522	550
3	Dissolved Solids	312	486	509
4	D.Oxygen	6.2	4.9	4.7
5	BOD	2	2.8	3
6	COD	18	30	38
7	Turbidity	8	42.6	50
8	Conductivity	408	693.31	700
9	Chromium	ND	ND	ND
10	Lead	ND	ND	ND
11	Zinc	ND	ND	ND
12	Copper	ND	ND	ND

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

Idol Immersion at Pithampur ,Dhar.

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.83	7.88	7.44
2	Total Solids	993	244	768
3	Dissolved Solids	958	233	737
4	D.Oxygen	4	6.6	3.9
5	BOD	2	1.4	2.2
6	COD	31.94	18	32
7	Turbidity	23.5	4.3	8.6
8	Conductivity	1452	354	1054
9	Chromium	0.24	ND	ND
10	Lead	ND	ND	ND
11	Zinc		—	—
12	Copper	0.16	ND	ND

Water Monitoring Report during Durga IDOL Immersion

River Kulbahara,near Nagpur road bridge,chhindwada.

R.O.Chhindwada

S. No.		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.17	7.43	8.14
2	Total Solids	511	493	566
3	Dissolved Solids	7	428	468
4	D.Oxygen	7	7.2	6.5
5	BOD	2	2	2.2
6	COD	12	12	24
7	Turbidity	4	2	8
8	Conductivity	688	611	716
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

S. No.	Chhota talab ,chhindwada,near railway station,road.			
		Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	6.83	1.84	8.83
2	Total Solids	923	599	923
3	Dissolved Solids	701	487	701
4	D.Oxygen	6.8	7.1	6.8
5	BOD	2.8	2.8	2.8
6	COD	36	16	38
7	Turbidity	18	4	18
8	Conductivity	1114	777	1114
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Pench near singori road bridge, chhindwada.

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.43	8.14	7.47
2	Total Solids	411	561	566
3	Dissolved Solids	345	472	470
4	D.Oxygen	7.2	7.2	7
5	BOD	2	2	2.2
6	COD	8	12	16
7	Turbidity	3	4	6
8	Conductivity	619	816	716
9	Lead	BDL	BDL	BDL
10	Zinc	BDL	BDL	BDL
11	Copper	BDL	BDL	BDL

R.O. Sagar

Water Monitoring Report during Durga IDOL Immersion

Putra lake, Damoh

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.78	7.94	7.68
2	Total Solids	642	716	682
3	Dissolved Solids	604	634	606
4	D.Oxygen	6.72	4.32	5.5
5	BOD	4.22	12.8	5.62
6	COD	11.64	27.16	19.4
7	Turbidity	53.7	84.6	66.2
8	Conductivity	809.6	947.8	816.2
9	Chromium	BDL	0.028	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Budha Bandh, Chhatarpur

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.65	7.88	7.68
2	Total Solids	412	566	452
3	Dissolved Solids	366	402	372
4	D.Oxygen	6.38	5.12	6.32
5	BOD	3.76	4.94	3.82
6	COD	16	9.04	18.92
7	Turbidity	36	88	42
8	Conductivity	548.6	603.6	558.4
9	Chromium	BDL	0.05	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

River Amanvi,at Lahendra naka,sagar

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.38	7.96	7.48
2	Total Solids	766	968	796
3	Dissolved Solids	692	784	684
4	D.Oxygen	8.38	3.62	6.18
5	BOD	4.24	16.25	5.92
6	COD	23.28	58.2	27.16
7	Turbidity	52	268	78
8	Conductivity	798.4	940.8	847.6
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Dharam Sagar lake,Panna.

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.36	7.92	7.69
2	Total Solids	212	428	340
3	Dissolved Solids	162	336	268
4	D.Oxygen	6.4	5.18	6.17
5	BOD	3.6	19.66	7.32
6	COD	12	58.2	22.7
7	Turbidity	76	104	88
8	Conductivity	243.4	504.6	402.4
9	Chromium	BDL	BDL	BDL
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Water Monitoring Report during Durga IDOL Immersion

Immersion kund near Mahendra sagar lake,Tikamgarh.

S. No.	parameter	Pre Immersion	During Immersion	After one week
		2023	2023	2023
1	pH	7.77	6.49	7.63
2	Total Solids	238	356	242
3	Dissolved Solids	176	192	184
4	D.Oxygen	6.28	4.36	5.96
5	BOD	2.62	7.88	3.48
6	COD	7.76	27.16	15.52
7	Turbidity	18	88	42
8	Conductivity	282.6	298.4	286.2
9	Chromium	BDL	0.051	0.055
10	Lead	BDL	BDL	BDL
11	Zinc	BDL	BDL	BDL
12	Copper	BDL	BDL	BDL

Durga IDOL Immersion-2023

Water Monitoring Report during Durga IDOL Immersion

R.O. Mandideep

Durga idol immersion kund ,Harbal park ,Hoshangabad,Mandideep.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.76	7.69	7.39
2	Dissolved Solids	178	622	508
3	D.Oxygen	7.8	3.9	4.1
4	BOD	1.2	5	4.2
5	COD	19.6	49	39.2
6	Turbidity	4.9	27.4	23.6
7	Conductivity	272	946	763
8	Chromium	BDL	BDL	BDL
9	Lead	0.28	0.28	0.09
10	Zinc	0.06	0.08	BDL
11	Copper	0.06	0.11	0.63

Visarjan kund near Richan river,Raisen.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.48	7.78	7.38
2	Dissolved Solids	228	538	466
3	D.Oxygen	7.5	4	4.4
4	BOD	1.4	4.7	3.8
5	COD	19.6	49	29.4
6	Turbidity	5.4	23.5	20.4
7	Conductivity	326	814	673
8	Chromium	BDL	BDL	BDL
9	Lead	0.49	0.48	0.1
10	Zinc	0.08	0.26	BDL
11	Copper	0.028	0.4	0.04

visarjan kund Jhiriya ghat near Mahaveer nagar,Mandideep.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.12	7.76	6.72
2	Dissolved Solids	276	178	602
3	D.Oxygen	7.3	7.8	3.5
4	BOD	1.6	1.2	5.1
5	COD	19.6	19.6	49
6	Turbidity	5.6	4.9	29.2
7	Conductivity	404	272	905
8	Chromium	BDL	BDL	BDL
9	Lead	0.48	0.48	0.14
10	Zinc	0.09	0.09	0.013
11	Copper	0.05	0.05	0.02

River Ajnal murti visarjan ghat,Harda.

Gupteshwar temple.

S. No.		Pre Immersion	During Immersion	After one week
1	pH	7.66	6.63	7.28
3	Dissolved Solids	192	624	524
4	D.Oxygen	7.9	3.1	4
5	BOD	11	5.6	4.4
6	COD	9.8	49	39.2
7	Turbidity	5.1	28.3	24.7
8	Conductivity	284	962	791
9	Chromium	BDL	BDL	BDL
10	Lead	0.54	0.47	0.08
11	Zinc	0.18	0.23	0.018
12	Copper	0.22	0.32	0.04